



Cobra^{MX}

Euro Compatible™ 7 Pin Owner's Manual

| | |
|-----------------|------------------------------------------------------------------------------|
| Product: | Cobra MX |
| Manual: | 091-0656 |
| Serial: | 11020001 |
| Voltage Rating: | 24 VDC |
| Revision: | Sept 2013 Rev C |
| Gun models: | 298-XXX A/C 1/4" 299-XXX W/C 1/4" 300-XXX A/C 3/8" 301-XXX W/C 3/8" |



175 Ampere Air Cooled, 1/4" tip
200 Ampere Air Cooled, 3/8" tip
225 Ampere Water Cooled, 1/4" tip
250 Ampere Water Cooled, 3/8" tip
Push-Pull Welding Guns

Table of Contents

| | |
|-----------------------------|-------|
| Safety Considerations | i-iii |
|-----------------------------|-------|

Installation Section A

| | |
|---------------------------------|---|
| Technical Specifications | 1 |
| Support Equipment Required..... | 1 |
| Coolant Requirements | 1 |
| Gun Lead Connections | 1 |

Operation.....Section B

| | |
|---------------------------------|---|
| General | 2 |
| Controls and Settings..... | 2 |
| Trigger Adjustment | 2 |
| Drive Roll and Idler Rolls..... | 3 |

AccessoriesSection C

| | |
|--------------------|---|
| Optional Kits..... | 4 |
| Conduits | 4 |
| Snake Skins | 4 |
| Contact Tips | 5 |
| Gas Cups | 6 |

MaintenanceSection D

| | |
|------------------------------------|---|
| Periodic Maintenance..... | 6 |
| Recommended Spare Parts List | 7 |

TroubleshootingSection E

| | |
|----------------------------|---|
| Troubleshooting Guide..... | 9 |
| Testing The Gun..... | 9 |

Appendices..... Section F

| | |
|----------------------------|----|
| Diagrams / Parts List..... | 11 |
| Mechanical | 12 |
| Electrical..... | 30 |

Safety Warnings

Warranty

Declaration of Conformity for European Community (CE) Products

Note  This information is provided for units with CE certification (see rating label on unit).

Manufacturer's Name: **MK Products, Inc.**
16882 Armstrong Ave.
Irvine, CA 92606

Declares that the product: **Cobra® MX Euro Compatible™**
conforms to the following Directives and Standards:

Directives

Low Voltage Directive: 2006/95/EC

Electromagnetic Compatibility (EMC) Directive: 2004/108/EC

Standards

Electromagnetic Compatibility, (EMC): EN 60974-10: 2007

Torches And Guns For Arc Welding, EN 60974-7: 2005

SAFETY CONSIDERATIONS

ELECTRIC ARC WELDING EQUIPMENT

CAUTION : READ BEFORE ATTEMPTING INSTALLATION, OPERATION OR MAINTENANCE OF THIS EQUIPMENT

1-1 INTRODUCTION

This equipment is intended for ultimate application by commercial/industrial users and for operation by persons trained and experienced in the use and maintenance of welding equipment. Operation should not be undertaken without adequate training in the use of such equipment. Training is available from many public and private schools or similar facilities.

Safe practices in the installation, operation and maintenance of this equipment requires proper training in the art, a careful study of the information provided with the equipment, and the use of common sense. Rules for safe use are generally provided by suppliers of welding power sources, compressed gas suppliers, and electrode suppliers. Careful compliance with these rules will promote safe use of this equipment.

The following Safety Rules cover some of the more generally found situations. READ THEM CAREFULLY. In case of any doubt, obtain qualified help before proceeding.

1-2 GENERAL PRECAUTIONS

A. Burn Prevention

ELECTRIC ARC WELDING PRODUCES HIGH INTENSITY HEAT AND ULTRAVIOLET RADIANT ENERGY WHICH MAY CAUSE SERIOUS AND PERMANENT EYE DAMAGE AND WHICH MAY DAMAGE ANY EXPOSED SKIN AREAS.

Wear helmet with safety goggles or glasses with side shields underneath, appropriate filter lenses or plates (protected by clear cover glass). This is a must for welding or cutting (and chipping) to protect the eyes from radiant energy and flying metal. Replace cover glass when broken, pitted, or spattered.

Medical first aid and eye treatment. First aid facilities and a qualified first aid person should be available for each shift unless medical facilities are close by for immediate treatment of flash burns of the eyes and skin burns.

Wear protective clothing - leather (or asbestos) gauntlet gloves, hat, and high safety-toe shoes. Button shirt collar and pocket flaps, and wear cuffless trousers to avoid entry of sparks and slag.

Avoid oily or greasy clothing. A spark may ignite them.

Flammable hair preparations should not be used by persons intending to weld or cut.

Hot metal such as electrode stubs and work pieces should never be handled without gloves.

Ear plugs should be worn when working on overhead or in a confined space. A hard hat should be worn when others work overhead.

B. Toxic Fume Prevention

WARNING: The use of this product may result in exposure to chemicals known

to the State of California to cause cancer and birth defects or other reproductive harm.

Adequate ventilation. Severe discomfort, illness or death can result from fumes, vapors, heat, or oxygen enrichment or depletion that welding (or cutting) may produce. Prevent them with adequate ventilation. NEVER ventilate with oxygen.

Lead-, cadmium-, zinc-, mercury-, beryllium-bearing and similar materials, when welded or cut, may produce harmful concentrations of toxic fumes. Adequate local exhaust ventilation must be used, or each person in the area, as well as the operator, must wear an air-supplied respirator. For beryllium, both must be used.

Metals coated with or containing materials that emit toxic fumes should not be heated unless coating is removed from the work surface, the area is well ventilated, or the operator wears an air-supplied respirator.

Work in a confined space only while it is being ventilated and, if necessary, while wearing an air-supplied respirator.

Gas leaks in a confined space should be avoided. Leaked gas in large quantities can change oxygen concentration dangerously. Do not bring gas cylinders into a confined space.

Leaving confined space, shut OFF gas supply at source to prevent possible accumulation of gases in the space if downstream valves have been accidentally opened or left open. Check to be sure that the space is safe before reentering it.

Vapors from chlorinated solvents can be decomposed by the heat of the arc (or flame) to form PHOSGENE, a highly toxic gas, and other lung and eye irritating products. The ultraviolet (radiant) energy of the arc can also decompose trichloroethylene and perchloroethylene vapors to form phosgene. DO NOT WELD or cut where solvent vapors can be drawn into the welding or cutting atmosphere or where the radiant energy can penetrate to atmospheres containing even minute amounts of trichloroethylene or perchloroethylene.

C. Fire and Explosion Prevention

Causes of fire and explosion are: combustibles reached by the arc, flame, flying sparks, hot slag, or heated material, misuse of compressed gases and cylinders, and short circuits.

BE AWARE THAT flying sparks or falling slag can pass through cracks, along pipes, through windows or doors, and through wall or floor openings, out of sight of the goggled operator. Sparks can fly many feet.

To prevent fires and explosion:

Keep equipment clean and operable, free of oil, grease, and (in electrical parts) of metallic particles that can cause short

circuits.

If combustibles are in area, do NOT weld or cut. Move the work if practicable, to an area free of combustibles. Avoid paint spray rooms, dip tanks, storage areas, ventilators. If the work cannot be moved, move combustibles at least 35 feet away, out of reach of sparks and heat; or protect against ignition with suitable and snug-fitting, fire-resistant covers or shields.

Walls touching combustibles on opposite sides should not be welded on (or cut). Walls, ceilings, and floor near work should be protected by heat-resistant covers or shields.

Fire watcher must be standing by with suitable fire extinguishing equipment during and for some time after welding or cutting if:

1. Appreciable combustibles (including building construction) are within 35 feet.

2. Appreciable combustibles are further than 35 feet, but can be ignited by sparks.

3. Openings (concealed or visible) in floors or walls within 35 feet may expose combustibles to sparks.

4. Combustibles adjacent to walls, ceilings, roofs, or metal partitions can be ignited by radiant or conducted heat.

Hot work permit should be obtained before operation to ensure supervisor's approval that adequate precautions have been taken.

After work is done, check that area is free of sparks, glowing embers, and flames.

An empty container that held combustibles, or that can produce flammable or toxic vapors when heated, must never be welded on or cut, unless container has first been cleaned in accordance with industry standards.

This includes: a thorough steam or caustic cleaning (or a solvent of water washing, depending on the combustible's solubility), followed by purging and inerting with nitrogen or carbon dioxide, and using protective equipment.

Water-filling just below working level may substitute for inerting.

A container with unknown contents should be cleaned (see paragraph above). Do NOT depend on sense of smell or sight to determine if it is safe to weld or cut.

Hollow castings or containers must be vented before welding or cutting. They can explode.

Explosive atmospheres. NEVER weld or cut where the air may contain flammable dust, gas, or liquid vapors (such as gasoline).

D. Compressed Gas Equipment

The safe handling of compressed gas equipment is detailed in numerous industry publications. The following general rules cover many of the most

common situations.

1. Pressure Regulators

Regulator relief valve is designed to protect only the regulator from overpressure; it is not intended to protect any downstream equipment. Provide such protection with one or more relief devices.

Never connect a regulator to a cylinder containing gas other than that for which the regulator was designed.

Remove faulty regulator from service immediately for repair (first close cylinder valve). The following symptoms indicate a faulty regulator:

Leaks - if gas leaks externally.

Excessive Creep - if delivery pressure continues to rise with downstream valve closed.

Faulty Gauge - if gauge pointer does not move off stop pin when pressurized, nor returns to stop pin after pressure release.

Repair. Do NOT attempt repair. Send faulty regulators for repair to manufacturer's designated repair center, where special techniques and tools are used by trained personnel.

2. Cylinders

Cylinders must be handled carefully to prevent leaks and damage to their walls, valves, or safety devices:

Avoid electrical circuit contact with cylinders including third rails, electrical wires, or welding circuits. They can produce short circuit arcs that may lead to a serious accident. (See 1-3C)

ICC or DOT marking must be on each cylinder. It is an assurance of safety when the cylinder is properly handled.

Identifying gas content. Use only cylinders with name of gas marked on them; do not rely on color to identify gas content. Notify supplier if unmarked. NEVER DEFACE or alter name, number, or other markings on a cylinder. It is illegal and hazardous.

Empties: Keep valves closed, replace caps securely; mark MT; keep them separate from FULLS, and return promptly.

Prohibited use. Never use a cylinder or its contents for other than its intended use, NEVER as a support or roller.

Locate or secure cylinders so they cannot be knocked over.

Passageways and work areas. Keep cylinders clear of areas where they may be stuck.

Transporting cylinders. With a crane, use a secure support such as a platform or cradle. Do NOT lift cylinders off the ground by their valves or caps, or by chains, slings, or magnets.

Do NOT expose cylinders to excessive heat, sparks, slag, and flame, etc. that may cause rupture. Do not allow contents to exceed 55 degrees C (130 degrees

F.) Cool with water spray where such exposure exists.

Protect cylinders, particularly valves from bumps, falls, falling objects, and weather. Replace caps securely when moving cylinders.

Stuck valve. Do NOT use a hammer or wrench to open a cylinder valve that cannot be opened by hand. Notify your supplier.

Mixing gases. NEVER try to mix any gases in a cylinder.

NEVER refill any cylinder.

Cylinder fittings should never be modified or exchanged.

3. Hose

Prohibited use. Never use hose other than that designed for the specified gas. A general hose identification rule is: red for fuel gas, green for oxygen, and black for inert gases.

Use ferrules or clamps designed for the hose (not ordinary wire or other substitute) as a binding to connect hoses to fittings.

No copper tubing splices. Use only standard brass fittings to splice hose.

Avoid long runs to prevent kinks and abuse. Suspend hose off ground to keep it from being run over, stepped on, or otherwise damaged.

Coil excess hose to prevent kinks and tangles.

Protect hose from damage by sharp edges, and by sparks, slag, and open flame.

Examine hose regularly for leaks, wear, and loose connections. Immerse pressured hose in water; bubbles indicate leaks

Repair leaky or worn hose by cutting area out and splicing. Do NOT use tape.

4. Proper Connections

Clean cylinder valve outlet of impurities that may clog orifices and damage seats before connecting regulator. Except for hydrogen, crack valve momentarily, pointing outlet away from people and sources of ignition. Wipe with a clean, lintless cloth.

Match regulator to cylinder. Before connecting, check that the regulator label and cylinder marking agree, and that the regulator inlet and cylinder outlet match. NEVER Connect a regulator designed for a particular gas or gases to a cylinder containing any other gas.

Tighten connections. When assembling threaded connections, clean and smooth seats where necessary. Tighten. If connection leaks, disassemble, clean, and retighten, using properly fitting wrench.

Adapters. Use a CGA adapter (available from your supplier) between cylinder and regulator, if one is required. Use two wrenches to tighten adapter marked

RIGHT and LEFT HAND threads.

Regulator outlet (or hose) connections may be identified by right hand threads for oxygen and left hand threads (with grooved hex on nut or shank) for fuel gas.

5. Pressurizing Steps:

Drain regulator of residual gas through suitable vent before opening cylinder (or manifold valve) by turning adjusting screw in (clockwise). Draining prevents excessive compression heat at high pressure seat by allowing seat to open on pressurization. Leave adjusting screw engaged slightly on single-stage regulators.

Stand to side of regulator while opening cylinder valve.

Open cylinder valve slowly so that regulator pressure increases slowly. When gauge is pressurized (gauge reaches regulator maximum) leave cylinder valve in following position: for oxygen and inert gases, open fully to seal stem against possible leak; for fuel gas, open to less than one turn to permit quick emergency shut-off.

Use pressure charts (available from your supplier) for safe and efficient recommended pressure settings on regulators.

Check for leaks on first pressurization and regularly thereafter. Brush with soap solution. Bubbles indicate leaks. Clean off soapy water after test; dried soap is combustible.

E. User Responsibilities

Follow all Safety Rules.

Remove leaky or defective equipment from service immediately for repair. Read and follow user manual instructions.

F. Leaving Equipment Unattended

Close gas supply at source and drain gas.

G. Rope Staging-Support

Rope staging-support should not be used for welding or cutting operation; rope may burn.

1-3 ARC WELDING

Comply with precautions in 1-1, 1-2, and this section. Arc Welding, properly done, is a safe process, but a careless operator invites trouble. The equipment carries high currents at significant voltages. The arc is very bright and hot. Sparks fly, fumes rise, ultraviolet and infrared energy radiates, weldments are hot, and compressed gases may be used. The wise operator avoids unnecessary risks and protects himself and others from accidents.

A. Burn Protection

Comply with precautions in 1-2.

The welding arc is intense and visibly bright. Its radiation can damage eyes, penetrate lightweight clothing, reflect from light-colored surfaces, and burn the skin and eyes. Skin burns resemble acute sunburn; those from gas-shielded arcs are more severe and painful.

DON'T GET BURNED; COMPLY WITH PRECAUTIONS.

1. Protective Clothing

Wear long-sleeve clothing in addition to gloves, hat, and shoes. As necessary, use additional protective clothing such as leather jacket or sleeves, flameproof apron, and fire-resistant leggings. Avoid outer garments of untreated cotton.

Bare skin protection. Wear dark, substantial clothing. Button collar to protect chest and neck, and button pockets to prevent entry of sparks.

2. Eye and Head Protection

Protect eyes from exposure to arc. Eyes may be damaged by radiant energy when exposed to the electric arc, even when not looking in the direction of the arc. Never look at an electric arc without protection.

Welding helmet or shield containing a filter plate shade no. 12 or denser must be used when welding. Place over face before striking arc.

Protect filter plate with a clear cover plate.

Cracked or broken helmet or shield should NOT be worn; radiation can be passed through to cause burns.

Cracked, broken, or loose filter plates must be replaced IMMEDIATELY. Replace clear cover plate when broken, pitted, or spattered.

Flash goggles with side shields MUST be worn under the helmet to give some protection to the eyes should the helmet not be lowered over the face before an arc is struck. Looking at an arc momentarily with unprotected eyes (particularly a high intensity gas-shielded arc) can cause a retinal burn that may leave a permanent dark area in the field of vision.

3. Protection of Nearby Personnel

Enclose the welding area. For production welding, a separate room or enclosed bay is best. In open areas, surround the operation with low-reflective, noncombustible screens or panels. Allow for free air circulation, particularly at floor level.

Viewing the weld. Provide face shields for all persons who will be looking directly at the weld.

Others working in area. See that all persons are wearing flash goggles.

Before starting to weld, make sure that screen flaps or bay doors are closed.

B. Toxic Fume Prevention

Comply with precautions in 1-2B.

Generator engine exhaust must be vented to the outside air. Carbon monoxide can kill.

C. Fire and Explosion Prevention

Comply with precautions in 1-2C.

Equipment's rated capacity. Do not overload arc welding equipment. It may overheat cables and cause a fire.

Loose cable connections may overheat

or flash and cause a fire.

Never strike an arc on a cylinder or other pressure vessel. It creates a brittle area that can cause a violent rupture or lead to such a rupture later under rough handling.

D. Compressed Gas Equipment

Comply with precautions in 1-2D.

E. Shock Prevention

Exposed electrically hot conductors or other bare metal in the welding circuit, or in ungrounded, electrically-HOT equipment can fatally shock a person whose body becomes a conductor. DO NOT STAND, SIT, LIE, LEAN ON, OR TOUCH a wet surface when welding without suitable protection.

To protect against shock:

Keep body and clothing dry. Never work in damp area without adequate insulation against electrical shock. Stay on a dry duckboard, or rubber mat when dampness or sweat cannot be avoided. Sweat, sea water, or moisture between body and an electrically HOT part - or grounded metal - reduces the body surface electrical resistance, enabling dangerous and possibly lethal currents to flow through the body.

1. Grounding the Equipment

When installing, connect the frames of each unit such as welding power source, control, work table, and water circulator to the building ground. Conductors must be adequate to carry ground currents safely. Equipment made electrically HOT by stray currents may shock, possibly fatally. Do NOT GROUND to electrical conduit, or to a pipe carrying ANY gas or a flammable liquid such as oil or fuel.

Three-phase connection. Check phase requirement of equipment before installing. If only three-phase power is available, connect single-phase equipment to only two wires of the three-phase line. Do NOT connect the equipment ground lead to the third (live) wire, or the equipment will become electrically HOT - a dangerous condition that can shock, possibly fatally.

Before welding, check ground for continuity. Be sure conductors are touching bare metal of equipment frames at connections.

If a line cord with a ground lead is provided with the equipment for connection to a switch box, connect the ground lead to the grounded switch box. If a three-prong plug is added for connection to a grounded mating receptacle, the ground lead must be connected to the ground prong only. If the line cord comes with a three-prong plug, connect to a grounded mating receptacle. Never remove the ground prong from a plug, or use a plug with a broken ground prong.

2. Connectors

Fully insulated lock-type connectors should be used to join welding cable lengths.

3. Cables

Frequently inspect cables for wear, cracks, and damage. IMMEDIATELY REPLACE those with excessively worn or damaged insulation to avoid possibly lethal shock from bared cable. Cables with damaged areas may be taped to give resistance equivalent to original cable.

Keep cable dry, free of oil and grease, and protected from hot metal and sparks.

4. Terminals and Other Exposed Parts

Terminals and other exposed parts of electrical units should have insulating covers secured before operation.

5. Electrode Wire

Electrode wire becomes electrically HOT when the power switch of gas metal-arc welding equipment is ON and welding gun trigger is pressed. Keep hands and body clear of wire and other HOT parts.

6. Safety Devices

Safety devices such as interlocks and circuit breakers should not be disconnected or shunted out.

Before installation, inspection, or service of equipment, shut OFF all power, and remove line fuses (or lock or red-tag switches) to prevent accidental turning ON of power. Disconnect all cables from welding power source, and pull all 115 volts line-cord plugs.

Do not open power circuit or change polarity while welding. If, in an emergency, it must be disconnected, guard against shock burns or flash from switch arcing.

Leaving equipment unattended. Always shut OFF, and disconnect all power to equipment.

Power disconnect switch must be available near the welding power source.

Thank You

For selecting a quality product. We want you to take pride in operating this product...as much pride as we have in bringing the product to you!

Please Examine Carton and Equipment For Damage Immediately

When this equipment is shipped, title passes to the purchaser upon receipt by the carrier. Consequently, claims for material damaged in shipment must be made by the purchaser against the transportation company at the time the shipment is received.

Please record your equipment identification information below for future reference. This information can be found on your machine nameplate.

Model Name & Number _____

Code & Serial Number _____

Date of Purchase _____

Whenever you request replacements parts for, or information on this equipment always supply the information you have recorded above.

Read this Owner's Manual completely before attempting to use this equipment. Save this manual and keep it handy for quick reference. Pay particular attention to the safety instructions we have provided for your protection.

Section A



Installation

Technical Specifications

Wire Capacity

.030" - .045" (0.8mm - 1.2mm) solid hard wire, and cored wire
.030" - 1/16" (0.8mm - 1.6mm) aluminum

Wire Speed

800 IPM (20.3 mpm) max

Duty Cycle - 60%

All ratings are using Argon gas

175 Amps/25 Volts Air Cooled, 1/4" Tip (Model 298)

200 Amps/25 Volts Air Cooled, 3/8" Tip (Model 300)

225 Amps/25 Volts Water Cooled, 1/4" Tip (Model 299)

250 Amps/25 Volts Water Cooled, 3/8" Tip (Model 301)

Support Equipment Required

- C.V. or C.C. power source of sufficient capacity for your needs.
- Regulated gas supply and hoses.
- Properly sized power leads from power source to wire feeder and ground.
- Water source and hose capable of providing a minimum of **1 quart (.95 liter) / min. at 45 p.s.i.** when using water cooled guns.

Coolant Requirements

WARNING: Use only Cobra Coolant - failure to use coolant will void warranty.

Use Cobra Coolant (Aluminum Protection), which does not contain reactive sulphur or chlorine and does not react with copper, brass or aluminum. The Cobra Coolant is available in quantities of 1 gallon (P/N 931-0060), 5 gallon (P/N 931-0060-5GAL), or a case of 4 gallons each (P/N 931-0060-4).

The coolant flow rate should be a minimum of 10 GPH (1 qt/min) between 35 and 45psi. Contact the re-circulator manufacturer for specifications on pressure.

Gun Lead Connections

Power Cable - Air Cooled

A #2 power cable is used on the Cobra MX Euro Compatible 7 Pin gun. The gun and Euro Power Manifold ends of the cable are stripped to the copper strands and wrapped with a copper strip. A setscrew holds the cable securely in the gun body and in the Euro Power Manifold with torque requirements of 55-60 in-lb.

Power Cable - Water Cooled

The Cobra MX Euro Compatible 7 Pin water cooled gun utilizes a power/water cable with a #6 AWG cable inside a 5/16" diameter hose.

The power cable ends are threaded fittings which screw into the gun body and the Euro Power Manifold. These connections utilize a conductive sealant and are tightened with torque requirements of 100 ± 5 IN-LB.

Conduit

The Cobra MX Euro Compatible 7 Pin gun comes standard with a poly-lined conduit, for feeding aluminum wire. The longer fitting with a shallow groove is used on the gun end. A set screw located on top of the gun handle secures the conduit in place. The cabinet end of the conduit is secured into the Euro Power Manifold with a set screw.

Gas Hose

The BLACK gas hose is pushed over a barbed fitting on the end of the gun body and secured by twisting the hose retainer to the end of the hose (shown next page). The opposite end of the BLACK hose is pushed over a barbed fitting in the Euro Power Manifold. The hose retainer is re-usable and can be removed and re-installed as needed.



Coolant Connections

If so equipped, the ends of the coolant hose push over a barbed fitting on the end of the gun body and are secured by twisting the hose retainer to the end of the hose. The hose retainer is re-usable and can be removed and re-installed as needed.

The BLUE coolant supply hose pushes over a barbed fitting on the end of the gun body and is secured by twisting the hose retainer to the end of the hose. The hose retainer is re-usable and can be removed and re-installed as needed. The opposite end of the BLUE hose pushes into a threaded coolant fitting.

The RED coolant return hose pushes over the barbed fitting in the Power Manifold. The opposite end of the RED hose pushes into a threaded return hose of the coolant recirculator.

Both the BLUE and RED threaded fittings on the end of the BLUE and RED hoses, are standard left-hand thread. MK Products compatible guns have interchangeable fittings, so you can match as needed for your cooler. Both types of fittings require a hose retainer.



Control Cable

A multi-conductor control cable is used on the Cobra MX Euro Compatible 7 Pin. The gun end of the cable is secured with a cable clamp and the wires are connected to the potentiometer, the micro switch, the motor and the gun body mechanically. Slack is left in the electric cable as it exits the back of the gun to prevent cable and/or wire breakage. The cabinet end has a seven pin "W" clocked amphenol connector.

Section B

Operation

General

The Cobra MX Euro Compatible 7 Pin gun maintains a constant, steady, uniform wire feed speed, regardless of curved or looped wire conduit. The constant push exerted by the slave motor in the cabinet, combined with the pull of the gun motor, causes the wire to literally float friction-free through the wire conduit. The 24VDC gun motor is controlled by a three and three-quarter (3 3/4) turn potentiometer in the gun handle.

Controls and Settings

Potentiometer

The laterally-positioned potentiometer is located in the lower end of the handle, providing up to 800 ipm with 3 3/4 turns.

Micro Switch



The micro switch assembly consists of the micro switch, and leads.

Trigger Sensitivity

The amount of trigger lever travel can be shortened for a quicker or more responsive action.

A more sensitive trigger lever is produced by reducing the gap between the trigger lever and the micro switch lever. By turning-in the trigger sensitivity adjustment screw, it closed the gap between the

Trigger Sensitivity Adjustment Screw Location

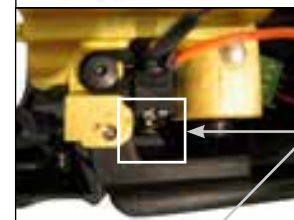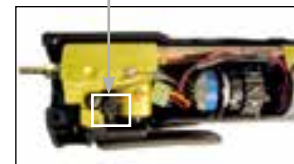

Screw adjusted out of trigger, pre-setting the micro-switch lever for shorter motion sensitivity.

trigger lever and the micro switch lever.

This will enable the operator to increase the sensitivity of the trigger lever.

Sensitivity Adjustment

With the wire feeder turned on (with or without welding wire loaded), turn the screw in until the micro-switch is activated. Once activated, the gun and wire feeder motors will begin feeding wire. Retract the screw accordingly until the system is deactivated and adjusted to the operators' liking.

Drive Roll and Idler Rolls

General

The Cobra MX Euro Compatible 7 Pin gun comes standard with a knurled drive roll and a grooved idler roll, which will handle aluminum wire with diameters of .030 to 1/16 inch and steel from .030 to .045 inches. Optional insulated V-groove drive rolls are also available for aluminum wire if desired (see optional kits).

Drive roll tension is accomplished with a unique spring-loaded pressure screw. The Cobra MX Euro Compatible 7 Pin comes from the factory with the pressure adjustment screw preset. **NO ADJUSTMENT IS REQUIRED FOR ALL SIZES AND TYPES OF WIRES.**

Drive Roll Installation/Removal

Note: Neither of the handles needs to be removed to access the drive or idler rolls.

1. Pull the cam lever away from the idler roll. This will relieve the pressure against the drive roll (as shown in Figure 1).
2. Align the drive roll removal tool (P/N 931-0100) over the flats of the drive roll (as shown in Figure 2). Hold the gun with one hand or on a table top, with the other hand give the removal tool a quick snap-turn in the **CLOCKWISE DIRECTION**.
3. Once the drive roll is loose, continue to spin drive roll in the clockwise direction to remove the drive roll from the gun.
4. Install a new drive roll on the left-hand threaded shaft. The drive roll will self-tighten when it is feeding wire.

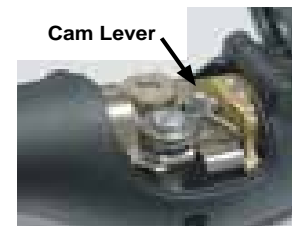


Figure 1



Figure 2

Idler Roll Installation and Removal

(Reference Figure 3)

1. Using a slot type screwdriver, loosen idler screw, taking care not to lose lock washer under idler roll.
2. Insert new idler roll and lock washer onto screw, insuring that idler groove is toward top and lock washer is beneath.
3. Tighten.

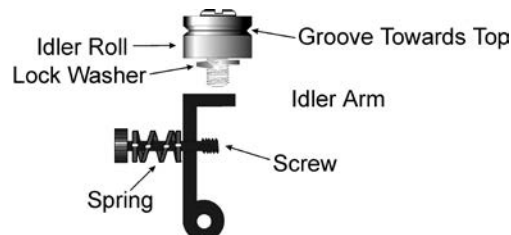


Figure 3

NOTE: Lock washer must be under idler roll or it will not turn freely.

Section C

Accessories

Optional Kits

Insulated Drive Roll Kits are used to prevent preheating of the aluminum wire which may soften it and clog the liner. This picking up of current at the drive rolls rather than at the contact tip is usually not a problem unless using too large of a contact tip or excessively oxidized aluminum wire.

Insulated Grooved Drive Roll Kit 005-0715

For .030" (0.8mm) dia. aluminum wire. Includes insulated groove drive roll and insulated idler roll assy.

Insulated Grooved Drive Roll Kit 005-0716

For .035" (0.9mm) dia. aluminum wire. Includes insulated groove drive roll and insulated idler roll assy.

Insulated Grooved Drive Roll Kit 005-0717

For .040" (1.0mm) dia. aluminum wire. Includes insulated groove drive roll and insulated idler roll assy.

Insulated Grooved Drive Roll Kit.....005-0718

For 3/64" (1.2mm) dia. aluminum wire. Includes insulated groove drive roll and insulated idler roll assy.

Insulated Grooved Drive Roll Kit.....005-0719

For .062" (1.6mm) dia. aluminum wire. Includes insulated groove drive roll and insulated idler roll assy.

Handle Kit.....005-0725

Includes left and right handles, screws and drive roll door.

Trigger Kit.....005-0726

Trigger kit includes a sensitivity adjustment screw replacement for all Cobra MX Euro Compatible 7 Pin guns.

Micro Switch Kit.....003-2274

Replacement micro switch assembly for all Cobra MX Euro Compatible 7 Pin guns.

Potentiometer Kit.....003-2190

Replacement potentiometer assembly for all Cobra MX Euro Compatible 7 Pin guns.

Conduits

Flat Spiral Steel Conduit for steel and cored wire. Standard with teflon liner.

615-0621-15 15 ft./4.5m

615-0621-25 25 ft./7.6m

615-0621-35 35 ft./10.7m

615-0621-50 50 ft./15.2m

Optional nickle tube liner.....003-2281

Snake Skins

Snake Skin protective covers are now standard on all guns. You may order spare replacement covers to protect the lead assy of the gun when the factory one becomes damaged or worn. It can easily be replaced in the field by means of Velcro®.

Snake Skin Cover 13ft (for 15ft leads) **931-0110**

Snake Skin Cover 23ft (for 25ft leads) **931-0122**

Snake Skin Cover 33ft (for 35ft leads) **931-0132**

Snake Skin Cover 48ft (for 50ft leads) **931-0123**

Gas Valve Removal Tool

Gas valve removal is often required to replace the standard valve stem with a modified valve stem (P/N 431-1080) when placing an older model gun on a newer model wire feeder. This is performed by using P/N 931-0105 Gas Valve Removal Tool. This multifunctional tool has been slotted on one side to encompass and conform to the gas valve stem and seat into the slotted gas valve body as seen in Figures 1 and 2. Removal of the gas valve can be accomplished by turning the gas valve tool counter clockwise. Reinstall by turning clockwise. The tool doubles as a bottle opener.



Gas Valve Removal Tool



Figure 1



Figure 2

Contact Tips (Models 300 and 301)



Heavy Duty Contact Tip - 3/8" Diameter*

| Wire Size | Tip ID | Arc | Tip Length | Part No. |
|---------------|----------------|-------|----------------|----------------------------|
| .030" (0.8mm) | .041" (1.0mm) | Spray | 1.57" (39.9mm) | 621-0390-25 |
| | | Short | 1.82" (46.2mm) | 621-0396-25 |
| .035" (0.9mm) | .044" (1.1mm) | Spray | 1.57" (39.9mm) | 621-0391-25 |
| | | | | 621-0391-250 [†] |
| | | | | 621-0391-500 ^{††} |
| .035" (0.9mm) | .044" (1.1mm) | Short | 1.82" (46.2mm) | 621-0397-25 |
| .045" (1.1mm) | .053" (1.35mm) | Short | 1.82" (46.2mm) | 621-0398-25 |
| 3/64" (1.2mm) | .053" (1.35mm) | Spray | 1.57" (39.9mm) | 621-0392-25 |
| | | | | 621-0392-250 [†] |
| | | | | 621-0392-500 ^{††} |
| 3/64" (1.2mm) | .060" (1.5mm) | Spray | 1.57" (39.9mm) | 621-0393-25** |
| | | | | 621-0393-250 [†] |
| | | | | 621-0393-500 ^{††} |
| 1/16" (1.6mm) | .074" (1.9mm) | Spray | 1.57" (39.9mm) | 621-0394-25 |
| | | Spray | | 621-0395-25 |
| | .085" (2.16mm) | | | 621-0395-25 |

*Use of tip removal tool is recommended

[†] Also sold in quantities of 250

**This size tip furnished with gun

^{††} Also sold in quantities of 500

Contact Tips (Models 298 and 299)



1/4" Diameter Contact Tip*

| Wire Size | Tip ID | Arc | Tip Length | Part No. |
|---------------------------------|-----------------|-------|-----------------|----------------------------|
| .023" (0.6 mm) | .031" (0.8 mm) | Spray | 1.50" (38.1 mm) | 621-0057-25 |
| .023" (0.6 mm) | .031" (0.8 mm) | Short | 1.75" (44.5 mm) | 621-0328-25 |
| .030" (0.8 mm) | .036" (0.9 mm) | Spray | 1.50" (38.1 mm) | 621-0325-25 |
| .030" (0.8 mm) | .037" (0.9 mm) | Short | 1.75" (44.5 mm) | 621-0326-25 |
| .035"/.030" (0.9 mm /0.8 mm) | .041" (1.0 mm) | Spray | 1.50" (38.1 mm) | 621-0076-25 |
| .035" (0.9 mm) | .044" (1.1 mm) | Spray | 1.50" (38.1 mm) | 621-0001-25 |
| | | | | 621-0001-250 [†] |
| | | | | 621-0001-500 ^{††} |
| .035" (0.9 mm) | .041" (1.0 mm) | Short | 1.75" (44.5 mm) | 621-0077-25 |
| .035" (0.9 mm) | .044" (1.1 mm) | Short | 1.75" (44.5 mm) | 621-0002-25 |
| 3/64" (1.2 mm) | .053" (1.35 mm) | Spray | 1.50" (38.1 mm) | 621-0327-25 |
| 3/64" (1.2 mm) | .060" (1.5 mm) | Spray | 1.50" (38.1 mm) | 621-0003-25** |
| | | | | 621-0003-250 [†] |
| | | | | 621-0003-500 ^{††} |
| 1/16" (1.6 mm) | .074" (1.9 mm) | Spray | 1.50" (38.1 mm) | 621-0075-25 |
| 1/16" (1.6 mm) | .085"(2.1 mm) | Spray | 1.50" (38.1 mm) | 621-0153-25 |

**This size tip furnished with gun

[†] Also sold in quantities of 250

* All tips sold in quantities of 25

^{††} Also sold in quantities of 500

(Models 300 and 301)



Spring Loaded Contact Tip - 3/8" Diameter


| Wire Size | Tip ID | Arc | Tip Length | Qty | Part Number |
|----------------|----------------|-------|-----------------|-----|-------------|
| .030" (0.8 mm) | .041" (1.0 mm) | Spray | 1.57" (39.9 mm) | EA | 621-0331 |
| .035" (0.9 mm) | .044" (1.1 mm) | Spray | 1.57" (39.9 mm) | EA | 621-0332 |
| 3/64" (1.2 mm) | .060" (1.5 mm) | Spray | 1.57" (39.9 mm) | EA | 621-0334 |
| 1/16" (1.6 mm) | .074" (1.9 mm) | Spray | 1.57" (39.9 mm) | EA | 621-0335 |



| MAX Cups (Models 300 and 301) | | Classic Cups (Models 298 and 299) | |
|----------------------------------|-----------|--------------------------------------|--------------|
| Cup I.D. | Part No. | Cup I.D. | Part No. |
| #6, 3/8" (9.5mm) | 621-0420 | #5, 1/4" (6.4mm) | 621-0079 |
| #8, 1/2" (12.7mm) | 621-0421* | #6, 3/8" (9.5mm) | 001-0137-4† |
| #10, 5/8" (15.9mm) | 621-0422 | #8, 1/2" (12.7mm) | 001-0138-4** |
| | | #10, 5/8" (15.8mm) | 001-0139-4† |

*standard - furnished with gun

 †sold in packs of 4 each



Tip Extender

Gun Barrel Liners

| Part Number | Description |
|-------------|---------------------------------------------|
| 931-0137 | Teflon liner package, 5 pieces |
| 615-0341 | Steel wire only, .030 - 1/16" (0.8 - 0.9mm) |
| 621-0423 | Tip Extender, MAX Cup (stackable) |
| 621-0017 | Tip Extender, Classic Cup (stackable) |
| 615-0248 | Spiral steel liner for tip extender |

Section D

Maintenance

Periodic Maintenance

Your Cobramatic system is designed to provide years of reliable service.

Maintenance of the gun will normally consist of a general cleaning of the wire guide system, including barrels, drive rolls, and conduits at regular intervals.

Remove spatter build-up from inside of nozzles with a hardwood stick.

The only parts on the Cobramatic system that are subject to normal wear are the conduit, contact tips, gas cups, front body liners, wire guides, drive and idler rolls. A supply of these parts should be maintained on hand.

The number of units in operation and the importance of minimal down time will determine to what extent spare parts should be stocked on hand. See the recommended spare parts list for the most commonly replaced parts.

If repairs do become necessary, qualified shop maintenance personnel can easily replace any part.

Maintenance Tools

| Tool | Part Number |
|--------------------------|-------------|
| Contact Tip Removal Tool | 931-0044 |
| Drive Roll Removal Tool | 931-0100 |

Recommended Spare Parts List

| Qty. | Part No. | Description |
|------|-------------|------------------------|
| 1 | 615-0620-15 | Conduit - 15 ft |
| 1 | 615-0620-25 | Conduit - 25 ft |
| 1 | 615-0620-35 | Conduit - 35 ft |
| 1 | 615-0620-50 | Conduit - 50 ft |
| 2 | 005-0726 | Trigger Assy Kit |
| 2 | 003-2190 | Potentiometer Assy Kit |
| 1 | 005-0725 | Handle Kit |
| 2 | 003-2274 | Micro-Switch Assy Kit |
| 10 | 511-0101 | Drive Roll |
| 5 | 511-0001 | Idler Roll |



DRIVE ROLL REMOVAL TOOL
931-0100



KNURLED DRIVE ROLL
511-0101



IDLER ROLL
511-0001
(.030" - 3/64")



IDLER ROLL
511-0113
(.023")



MICRO SWITCH ASSY
003-2274

Section E

Troubleshooting

| Trouble | Cause | Remedy |
|-----------------------------------------------------------------------------------|----------------------------------------------------|---------------------------------------------------------------------------------------------------------------|
| No wire feed at gun, feeder not operating, i.e. no slave motor or brake solenoid. | Input power fuse in feeder/control box blown | Replace fuse. |
| | Micro-switch defective/not being activated | Replace switch. Check switch for operation. |
| | Broken electrical cable | Check micro-switch wires for continuity. |
| No wire feed at gun, feeder operating properly. | Motor control fuse in feeder/control box blown | Check motor leads for shorts; then replace fuse. |
| | Bad potentiometer | Check potentiometer with meter. |
| | Broken electrical cable. | Check motor and potentiometer wires for continuity. |
| | Bad speed control/PCB. | See specific cabinet/control box owner's manual for speed control operation. |
| Wire feeds, but welding wire is not energized. | Loose or no cable connections. | Check all power connections. |
| | Contactor control cable loose or in wrong position | Check power supply owner's manual for location and type of contactor signal required, i.e. closing or 115VAC. |
| | Welding power source | Check power source. |
| Wire feeds erratically. | Dirty or worn conduit | Blow out or replace conduit. |
| | Wrong size contact tip | See contact tip table. |
| | Idler roll stuck | Check for lock washer under idler roll, or replace if damaged. |
| Wire feeds one speed only. | Bad potentiometer | Check with meter. |
| | Broken electrical cable | Check potentiometer wires for continuity or short. |
| | Bad speed control | See specific cabinet/control owner's manual for speed control operation. |
| Wire walks out of drive rolls. | Idler roll upside-down | Place groove in idler roll toward top. |
| | Rear wire guide missing | Replace wire guide. |

Troubleshooting Guide

Regardless of which gun or feeder used, all MK Products' push-pull guns operate on the same principle. The slave motor in the feeder runs at a fast, constant speed, but has very low torque. It is always trying to feed more wire than the gun motor wants, and when the motor gets all it wants, it slows the slave motor, preventing a bird's nest. Because of the low torque produced by the slave motor, a brake system is used to prevent wire overrun rather than tension. The drag adjustment in the feeder is used simply to keep the wire slightly taut, so it will not pull off the spool while feeding wire.

The high torque 24VDC gun motor is controlled by a solid state speed control located in the feeder, and a pot located in the gun. The gun motor, potentiometer, and micro switch are connected to the cabinet/control box via a control cable and Amphenol connector. If this cable becomes damaged, a variety of symptoms can occur, depending on which wire(s) break. To test, check each wire for continuity and shorts.

Remember, the micro switch in the gun activates both the slave motor and gun motor circuits in the cabinet. Therefore, if the slave motor and brake solenoid operate, but the gun does not, look more toward the gun motor's 24 V circuits, speed control, control cable, or the gun motor. If nothing operates, look more toward the slave motor's input, micro switch leads, or micro switch.

Testing The Gun

Reference the "W" clocked gun wiring diagram on the Cobra MX Euro Compatible 7 Pin electrical diagram for information about pin-outs and locations.

Motor Check

Remove the gun connector from the cabinet.

Using the gun Amphenol connector, check the resistance across pins "A" and "B" (motor leads).

If an open circuit (more than **K ohms**) or short exist (less than **2 ohms**) exists, check the motor leads and motor independently.


Testing the Potentiometer - "W" Clocked

Using the gun amphenol connector, check the resistance across pin "D" (wiper) and pin "C". The resistance should vary from **0 - 5K ohms** as the potentiometer is turned.

Check the resistance across pin "D" (wiper) and pin "G". The resistance should vary from **5K - 0 ohms** as the potentiometer is turned.

Testing the Micro Switch

Using the gun amphenol connector, check for continuity across pins "E" and "F" when the trigger is pressed.

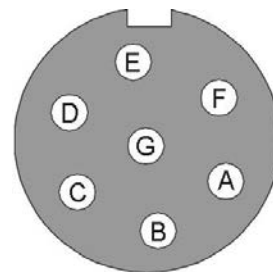

"W" Clocked
Amphenol Connector
Viewed from front of connector

THIS PAGE INTENTIONALLY BLANK


Section F

Appendices

Diagrams / Parts List

| | |
|-------------------------------------------------|----|
| Exploded View | 12 |
| Bill of Material | 13 |
| Front Body Assembly..... | 14 |
| Rear Body Assembly, Air Cooled | 15 |
| Rear Body Assembly, Water Cooled..... | 16 |
| Classic Cup Barrel Assembly, Air Cooled | 17 |
| Classic Cup Barrel Assembly, Water Cooled | 18 |
| MAX Barrel Assembly, Air Cooled..... | 19 |
| MAX Cup Barrel Assembly, Water Cooled..... | 20 |
| Spiral Wrap Installation..... | 21 |
| Lead Assembly, Air Cooled | 24 |
| Lead Assembly, Water Cooled..... | 26 |
| Power Manifold Assembly, Air Cooled | 28 |
| Power Manifold Assembly, Water Cooled | 29 |
| Electrical | 30 |

Cobra MX Euro Compatible 7 Pin Head Assembly

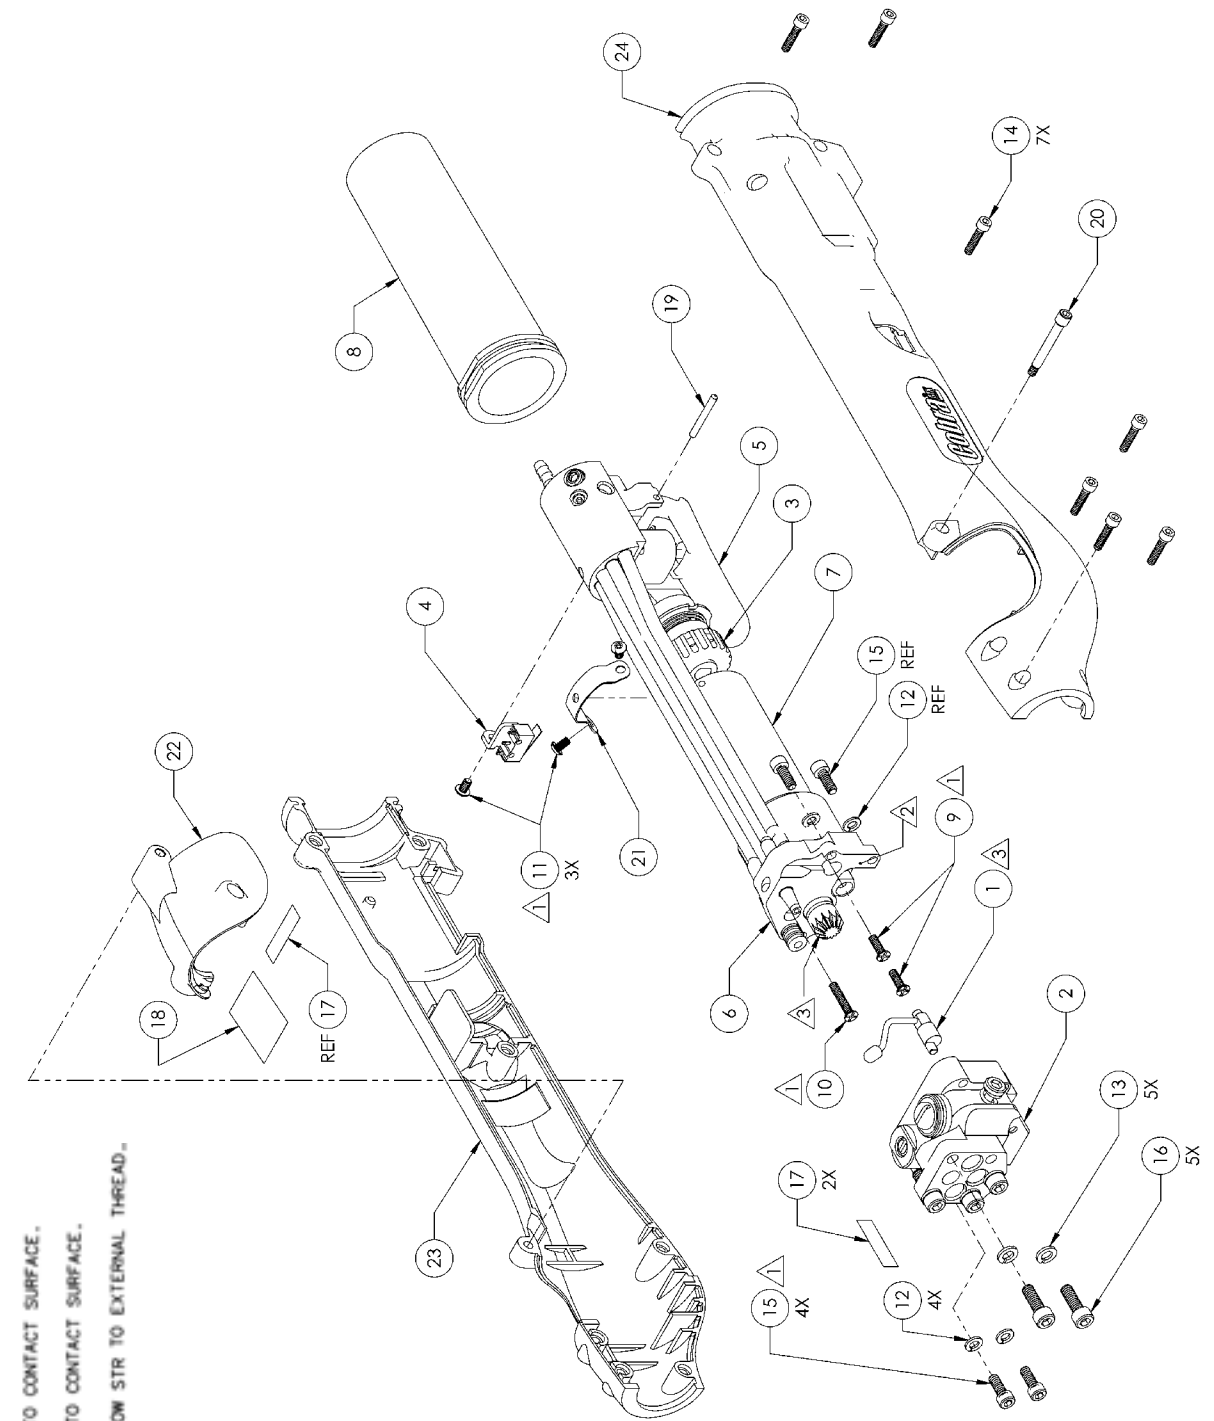


- ⚠️ APPLY COMPOUND GREASE TO CONTACT SURFACE.
- ⚠️ APPLY COMPOUND NACLOX TO CONTACT SURFACE.
- ⚠️ APPLY THREAD LOCKING LOW STR TO EXTERNAL THREAD.

Cobra MX Euro 7 Pin Compatible Air Cooled and Water Cooled Head Assembly


| No. | Qty. | Part No. | Description | No. | Qty. | Part No. | Description |
|-----|------|----------|-------------------------------|-----|------|----------|------------------------------------------------|
| 1 | 1 | 002-0629 | Assy Cam Idler Arm | 12 | 4 | 333-0260 | Wshr, Spr, LK #6 SST |
| 2 | 1 | 003-2141 | Front Body | 13 | 5 | 333-0261 | Wshr, Spr, LK #8 SST |
| 3 | 1 | 003-2190 | Assy Pot | 14 | 7 | 338-0014 | Scr Shc 4-40 x 1/2 SST |
| 4 | 1 | 003-2274 | Assy Switch | 15 | 4 | 338-0022 | Scr Shc 6-32 x 3/8 SST |
| 5 | 1 | 005-0726 | Trigger Kit | 16 | 5 | 338-0034 | Scr Shc 8-32 x 1/2 SST |
| 6 | 1 | 003-2397 | Assy Rear Body, AC | 17 | 2 | 405-0706 | Label Serial Plate |
| | 1 | 003-2398 | Assy Rear Body, WC | 18 | 1 | 405-1312 | Label Warning |
| 7 | 1 | 211-0085 | Standard Motor | 19 | 1 | 421-0452 | Pin Dowel 3/32 x 0.80 LG |
| | 1 | 211-0080 | High Speed Motor (optional) | 20 | 1 | 431-1892 | Scr Shoulder 1/8 Door MX |
| 8 | 1 | 301-0093 | Boot Torch | 21 | 1 | 435-1585 | Strap Motor |
| 9 | 2 | 319-0254 | Scr FH Phil 82 4-40 x 3/8 SST | 22 | 1 | 437-0253 | Door Molded |
| 10 | 1 | 319-0258 | Scr FH Phil 4-40 x 5/8 SST | 23 | 1 | 005-0725 | Handle Kit: Includes line items 14, 20, and 22 |
| 11 | 3 | 320-0101 | Scr Button 4-40 x 3/16 SST | | 24 | | |


Cobra MX Euro Compatible 7 Pin Front Body Assembly 003-2141

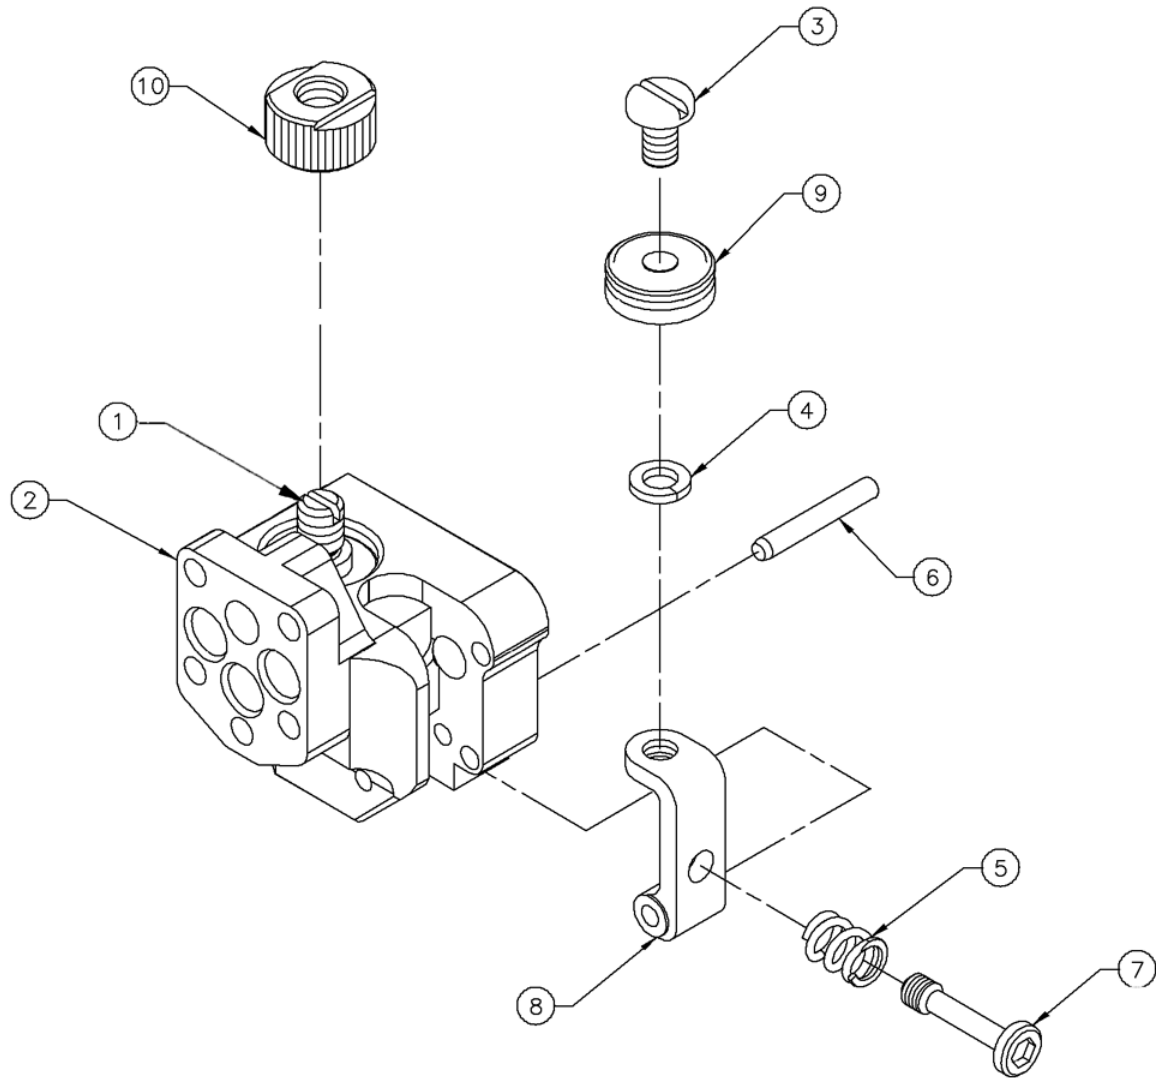


| Front Body Assembly | | | |
|----------------------------|------|----------|-------------------------------|
| No. | Qty. | Part No. | Description |
| 1 | - | - | Not available separately |
| 2 | - | - | Not available separately |
| 3 | 1 | 325-0206 | Scr Ph 10-24-3/8 |
| 4 | 1 | 333-0082 | Washer Lock 10 |
| 5 | 1 | 419-0092 | Spring Comp 0.31 OD x 0.20 ID |
| 6 | 1 | 421-0525 | Pin Dowel 1/8 x 7/8 Sst |
| 7 | 1 | 431-1663 | Scr Adjust Idler |
| 8 | 1 | 431-1598 | Arm Idler Python |
| 9 | 1 | 511-0001 | Assy Idler Wire Feed |
| 10 | 1 | 511-0101 | Drive Roll Gold |

Cobra MX Euro Compatible 7 Pin Rear Assembly, Air Cooled 003-2267

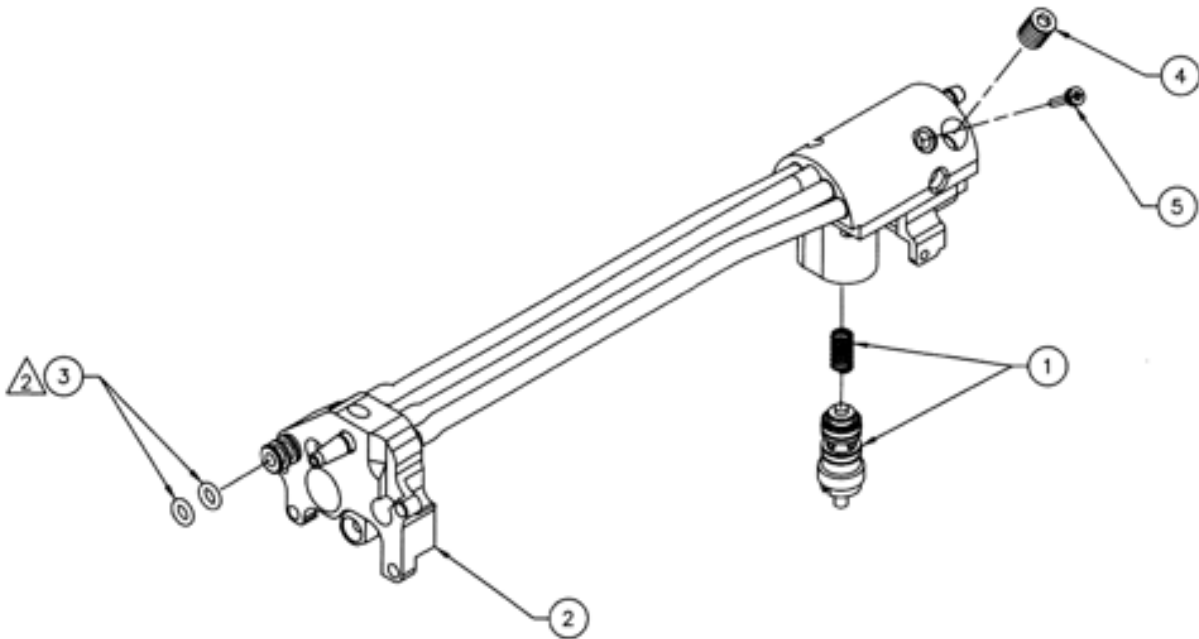



 APPLY SILICONE LUBRICANT TO O-RING BEFORE INSTALLING.

 ITEM NOT SHOWN FOR CLARITY.

| Air Cooled Rear Body Assembly | | | |
|---------------------------------------------------------------------------------------|------|----------|----------------------------------|
| No. | Qty. | Part No. | Description |
| 1 | 1 | 001-0562 | Assy Gas Valve |
| 2 | - | - | Not available separately |
| 3 | 2 | 303-0096 | O-Ring .145 ID x .07 W |
| 4 | 1 | 321-1082 | Set Screw Cup 1/4-20 x 3/8 SST |
| 5 | 1 | 321-1104 | Set Screw Conduit |
| 6  | 2 | 411-0020 | Tie Wrap (not shown for clarity) |

Cobra MX Euro Compatible 7 Pin Rear Assembly, Water Cooled 003-2276

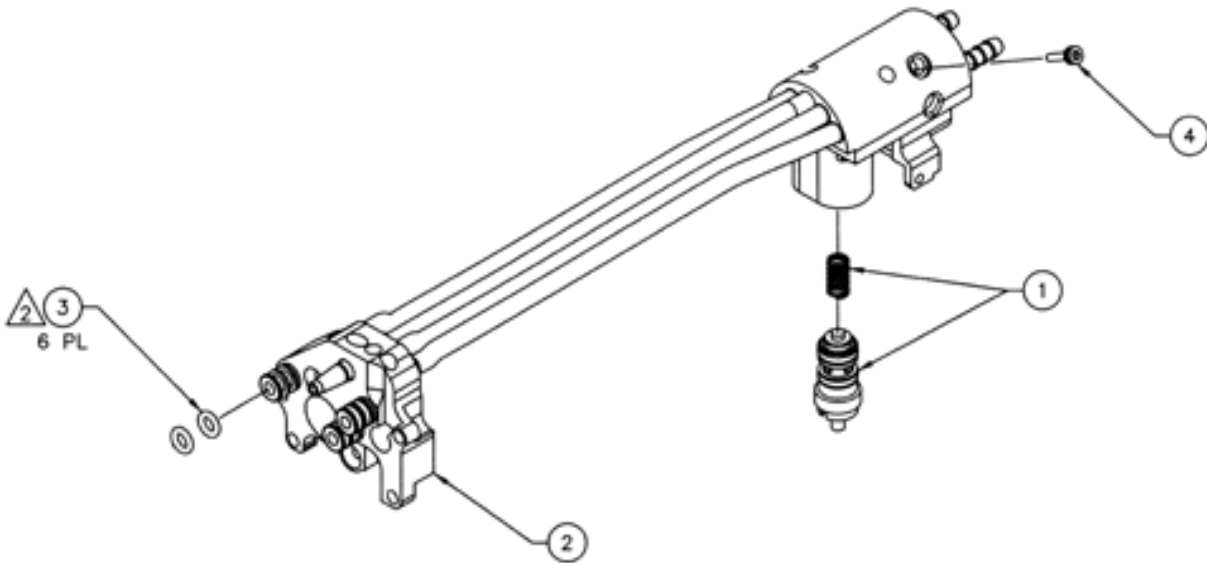


 APPLY SILICONE LUBRICANT TO O-RING BEFORE INSTALLING.

 ITEM NOT SHOWN FOR CLARITY.

Rear Body Assembly - Water Cooled

| No. | Qty. | Part No. | Description |
|-----|------|----------|----------------------------------|
| 1 | 1 | 001-0562 | Assy Gas Valve |
| 2 | - | - | Not available separately |
| 3 | 6 | 303-0096 | O-Ring .145 ID x .07 W |
| 4 | 1 | 321-1104 | Set Screw Conduit |
| 5△ | 2 | 411-0020 | Tie Wrap (not shown for clarity) |


Cobra MX Euro Compatible 7 Pin Classic Cup Barrel Assembly Air Cooled, 003-2341

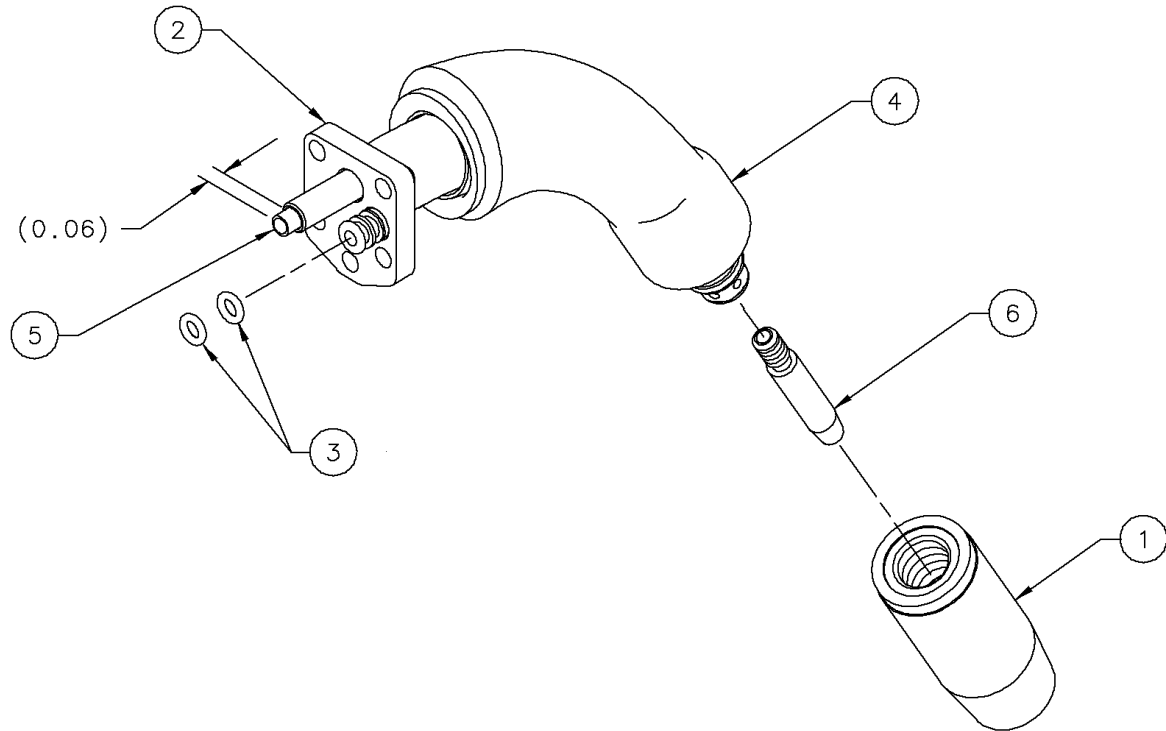

*Apply silicone lubricant to item 3 before installing.

| Classic Cup Barrel Assembly - Air Cooled | | | |
|------------------------------------------|------|----------|------------------------------|
| No. | Qty. | Part No. | Description |
| 1 | 1 | 001-0138 | Assy Gas Cup MK #8 |
| 2 | - | - | Not available separately |
| 3* | 2 | 303-0096 | O-Ring .145 ID x .07W |
| 4 | 1 | 437-0299 | Insulation Barrel |
| 5 | 1 | 931-0137 | 5-Piece Teflon Liner Package |
| 6 | 1 | 621-0003 | Tip 0.06 x 0.25 OD |


Cobra MX Euro Compatible 7 Pin Classic Cup Barrel Assembly Water Cooled, 003-2342

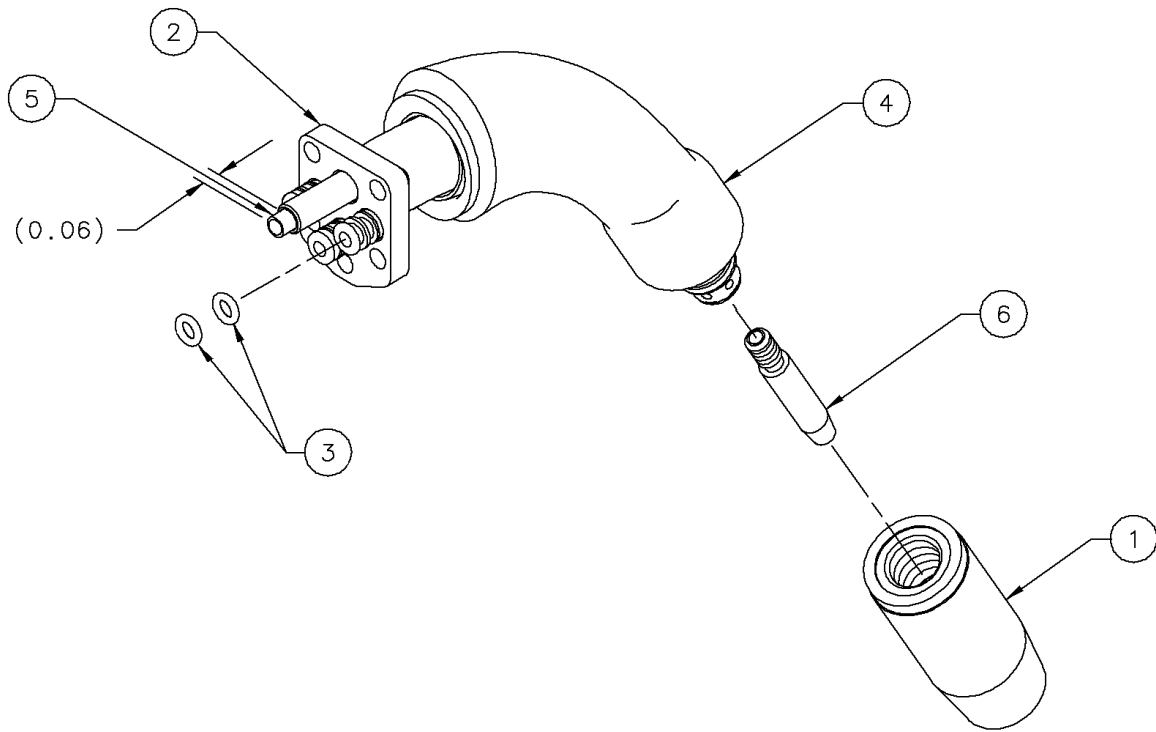

*Apply silicone lubricant to item 3 before installing.

| Classic Cup Barrel Assembly - Water Cooled | | | |
|--------------------------------------------|------|----------|------------------------------|
| No. | Qty. | Part No. | Description |
| 1 | 1 | 001-0138 | Assy Gas Cup MK #8 |
| 2 | - | - | Not available separately |
| 3* | 6 | 303-0096 | O-Ring .145 ID x .07W |
| 4 | 1 | 437-0299 | Insulation Barrel |
| 5 | 1 | 931-0137 | 5-Piece Teflon Liner Package |
| 6 | 1 | 621-0003 | Tip 0.06 x 0.25 OD |


Cobra MX Euro Compatible 7 Pin MAX Cup Barrel Assembly Air Cooled, 003-2343

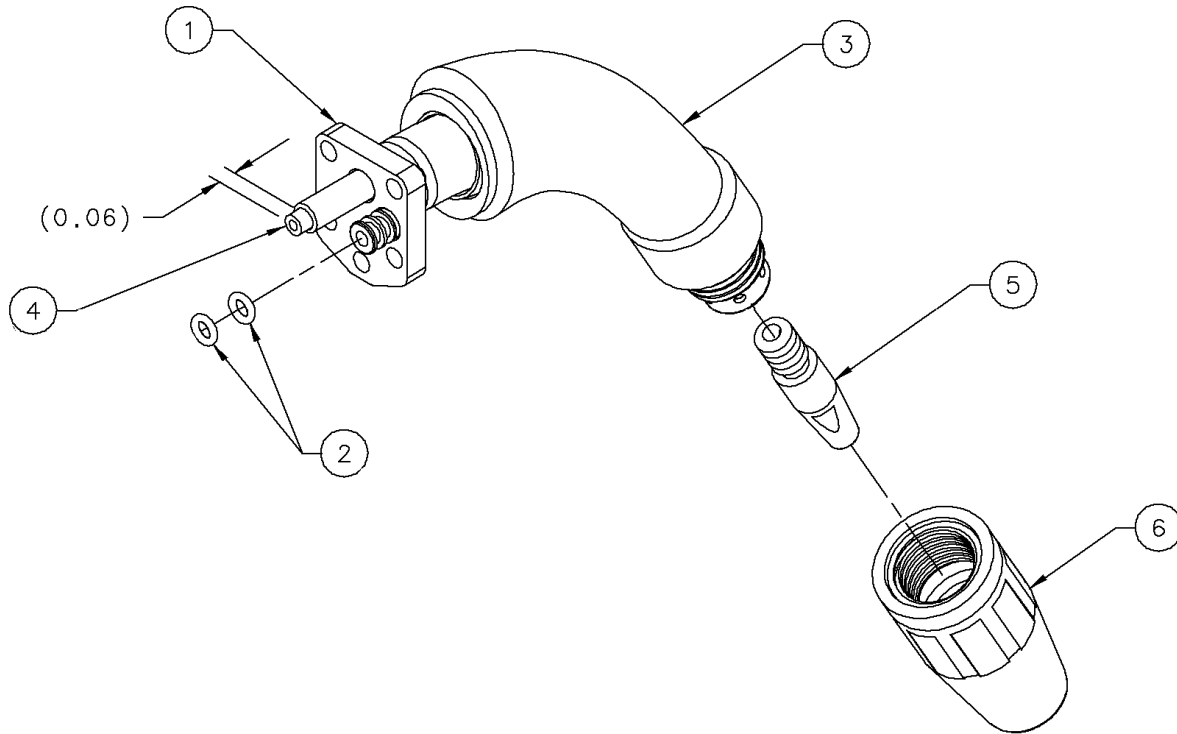

*Apply silicone lubricant to item 2 before installing.

| MAX Cup Barrel Assembly - Air Cooled | | | |
|--------------------------------------|------|----------|------------------------------|
| No. | Qty. | Part No. | Description |
| 1 | - | - | Not available separately |
| 2* | 6 | 303-0096 | O-Ring .145 ID x .07W |
| 3 | 1 | 437-0299 | Insulation Barrel |
| 4 | 1 | 931-0137 | 5-Piece Teflon Liner Package |
| 5 | 1 | 621-0393 | Tip HD Spray .060 |
| 6 | 1 | 621-0421 | Assy Gas Cup #8 CobraMAX |

Cobra MX Euro Compatible 7 Pin MAX Cup Barrel Assembly Water Cooled, 003-2344

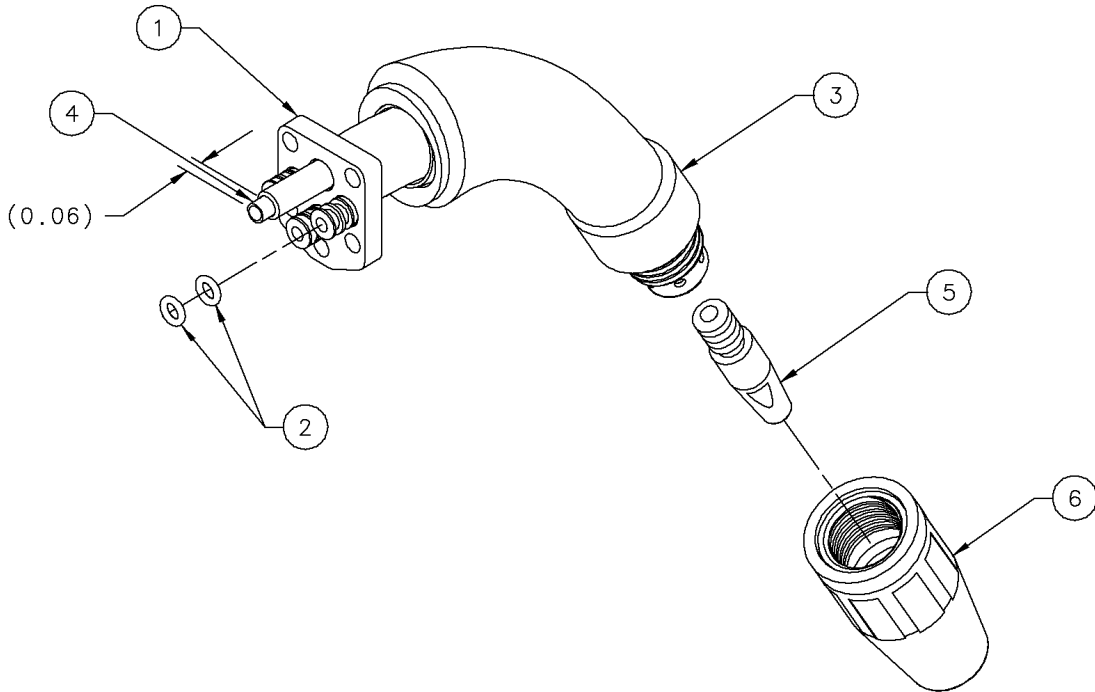


*Apply silicone lubricant to item 2 before installing.

| MAX Cup Barrel Assembly - Water Cooled | | | |
|----------------------------------------|------|----------|------------------------------|
| No. | Qty. | Part No. | Description |
| 1 | - | - | Not available separately |
| 2* | 6 | 303-0096 | O-Ring .145 ID x .07W |
| 3 | 1 | 437-0299 | Insulation Barrel |
| 4 | 1 | 931-0137 | 5-Piece Teflon Liner Package |
| 5 | 1 | 621-0393 | Tip HD Spray .060 |
| 6 | 1 | 621-0421 | Assy Gas Cup #8 CobraMAX |



Cobra MX Euro Compatible 7 Pin Lead Assembly Spiral Wrap Installation 033-0929

Gun End, Air Cooled

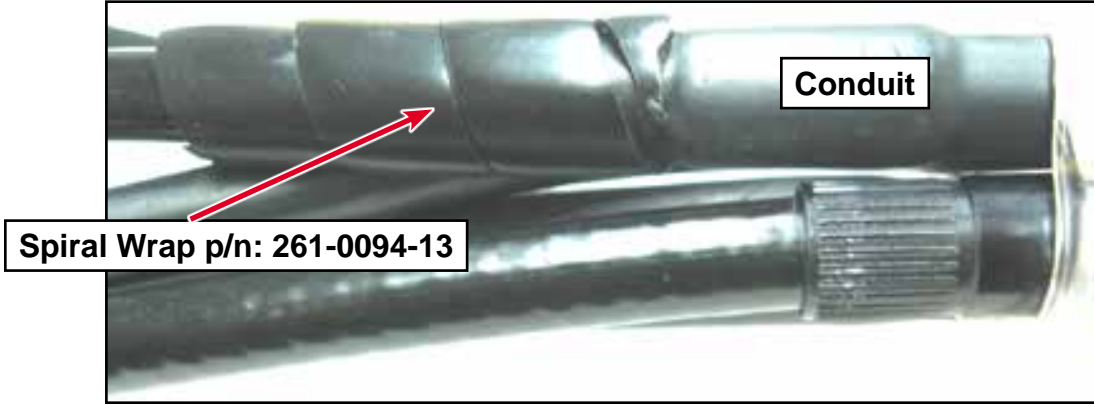

Cobra MX Euro Compatible 7 Pin Lead Assembly Spiral Wrap Installation 033-0929

Gun End, Water Cooled

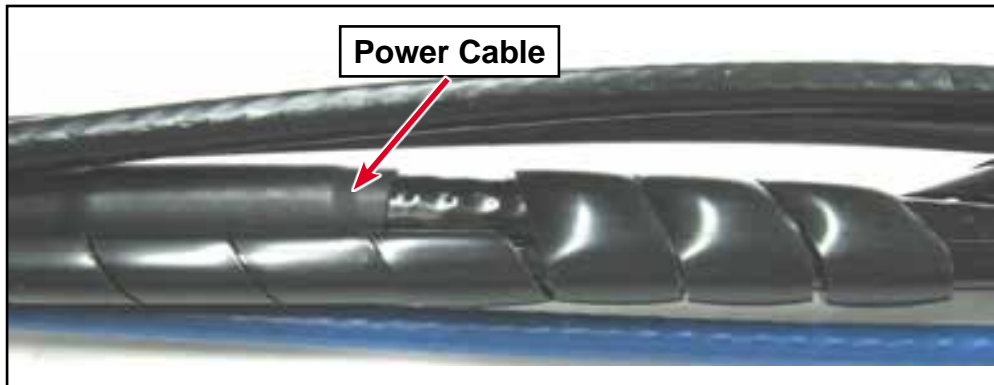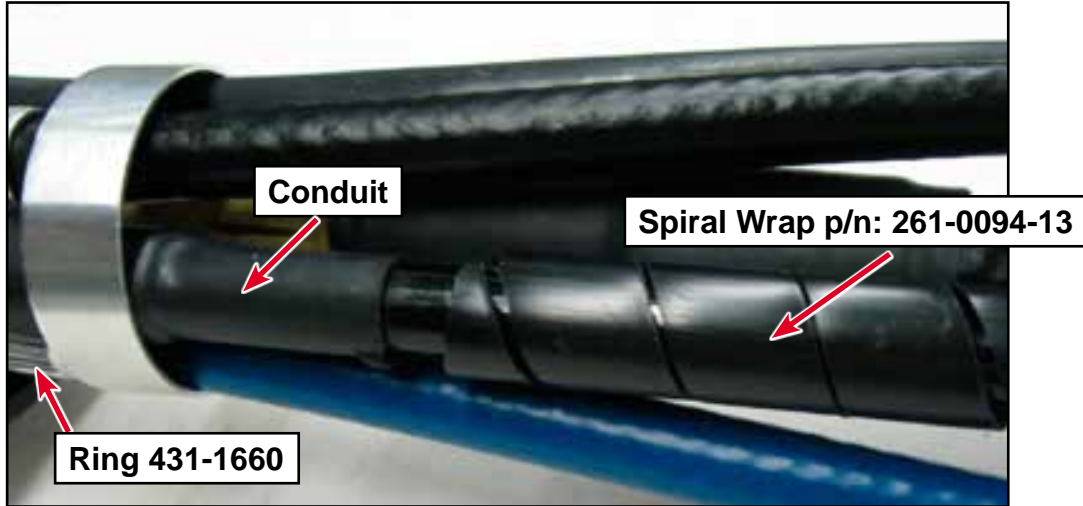


Cobra MX Euro Compatible 7 Pin Lead Assembly Spiral Wrap Installation 033-0929


Cabinet End, Air and Water Cooled



Spiral Wrap p/n: 261-0094

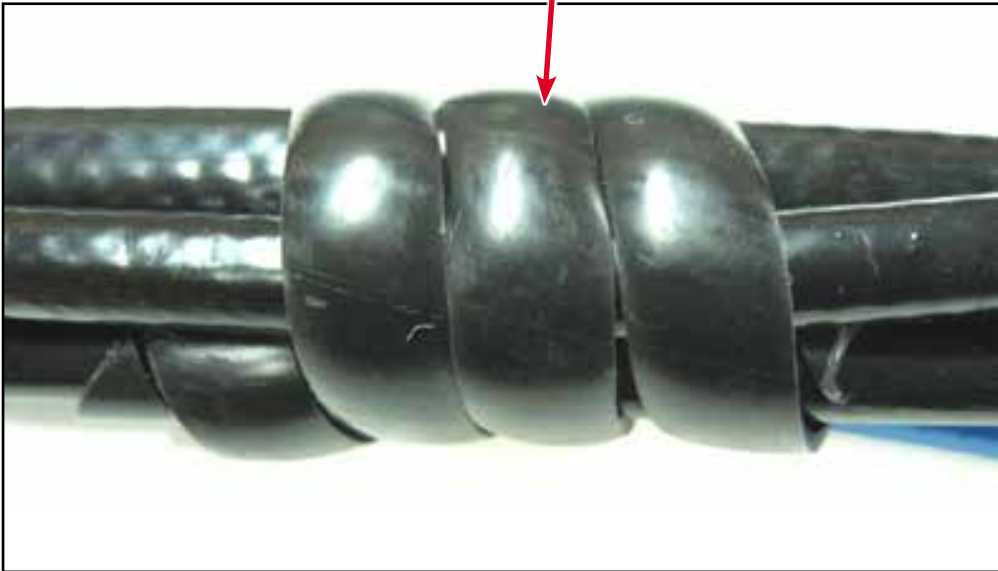

Cobra MX Euro Compatible 7 Pin Lead Assembly, Air Cooled

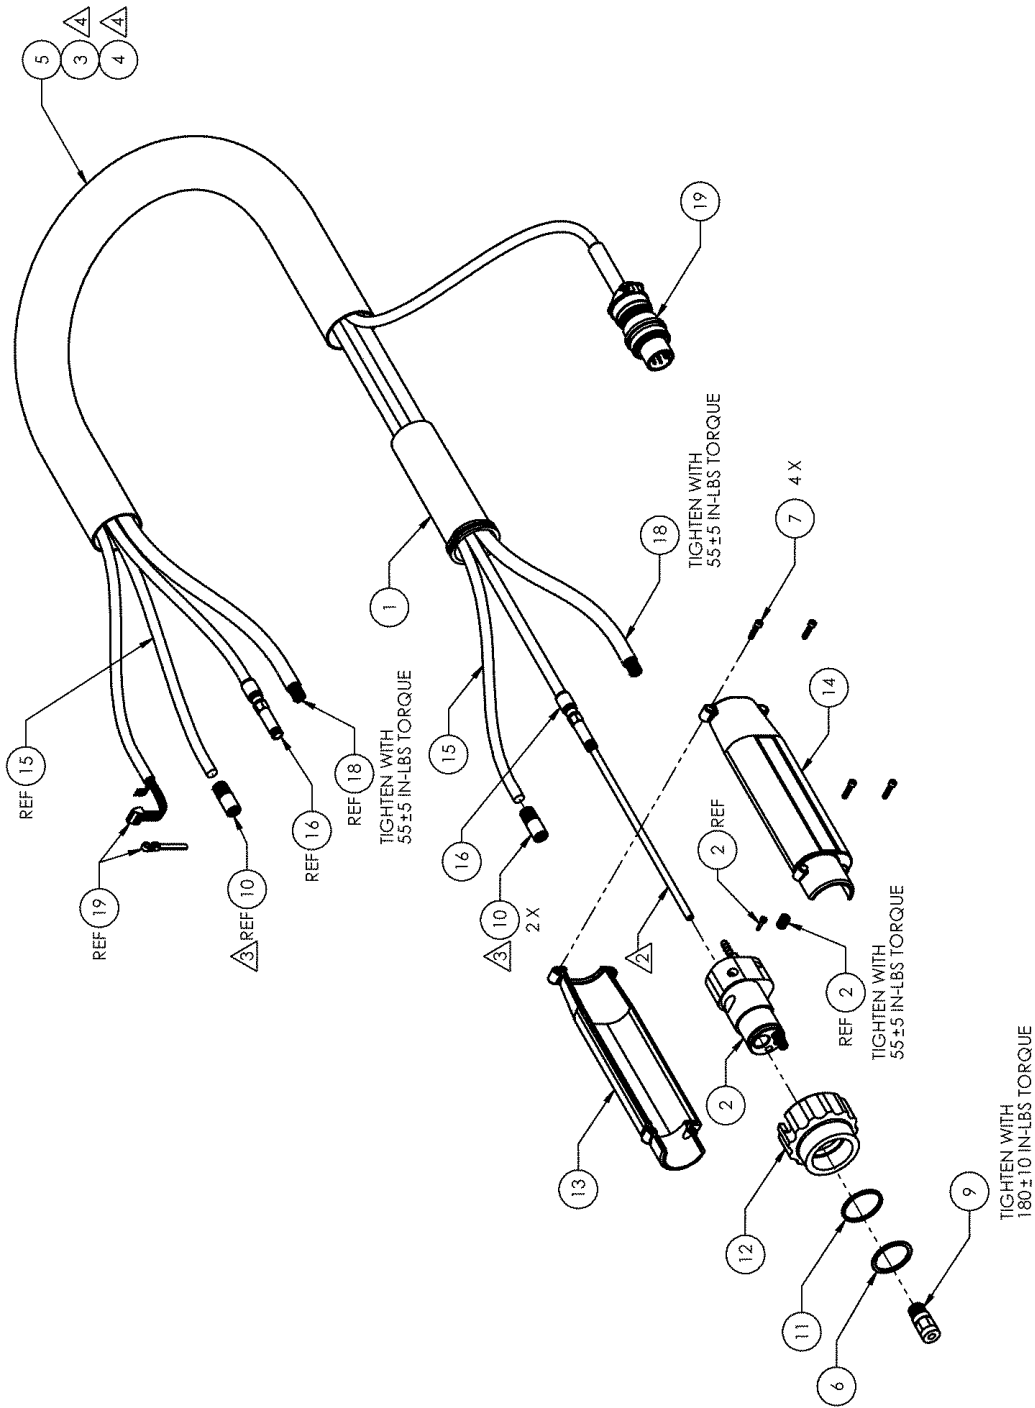


- SEE PROCEDURE #033-0929
- APPLY QUICK DRYING HOSE LUBRICANT NEAR BOTH ENDS OF ITEM (15) FOR INSTALLATION OF ITEM (10)
- TRIM TEFLON LINER AFTER ASSEMBLY. TEFLON LINER TO PROTRUDE 4.44 INCHES BEYOND ITEM (9)
- ITEM NOT SHOWN FOR CLARITY

| Lead Assembly - Air Cooled | | | | | | |
|----------------------------|------|-----------------------------------|--------------|----------------|--------------|--------------|
| No. | Qty. | Description | 15' Part No. | 25' Part No. | 35' Part No. | 50' Part No. |
| 1 | 1 | Assy Boot Torch | | 003-2153 | | |
| 2 | 1 | Assy Power Manifold, A/C | | 003-2373 | | |
| 3 | △ 1 | Wrap Spiral Cord, 5.5 in | | 261-0094 | | |
| 4 | △ 1 | Wrap Spiral Cord, 13 in | | 261-0094-13 | | |
| 5 | 1 | Snake Skin | 931-0110 | 931-0122 | 931-0132 | 931-0123 |
| 6 | 1 | Retainer Ring | | 313-0144 | | |
| 7 | △ 4 | Screw SHC 4-40 x 1/2 SST | | 338-0014 | | |
| 8 | 4 | Tie Wrap | | 411-0045 | | |
| 9 | 1 | Conduit Liner Fitting | | 431-1788 | | |
| 10* | 2 | Hose Retainer, 5/16 | | 431-1898 | | |
| 11 | 1 | Washer for Euro Connection | | 431-2052 | | |
| 12 | 1 | Nut Handle Adapter | | 437-0265 | | |
| 13 | 1 | Handle Kit: Includes item 7 | | 005-0385-BLACK | | |
| 14 | 1 | | | | | |
| 15 | 1 | Assy Gas Hose | 552-0241-15 | 552-0241-25 | 552-0241-35 | 552-0241-50 |
| 16 | 1 | Conduit Tef Tube | 615-0620-15 | 615-0620-25 | 615-0620-35 | 615-0620-50 |
| 17 | - | - | | ---- | | |
| 18** | 1 | Assy Power Cable Global | 843-0640-15 | 843-0640-25 | 843-0640-35 | 843-0640-50 |
| | 1 | Ultra Flex Power Cable (optional) | 843-0715-15 | 843-0715-25 | 843-0715-35 | 843-0715-50 |
| 19 | 1 | Assy Controller Cable | 005-0690 | 005-0691 | 005-0740 | 005-0692 |

* Hose Retainer is re-usable and can be removed and re-installed as needed

** Power Cable includes copper wrap P/N 701-0053-1

Cobra MX Euro Compatible 7 Pin Lead Assembly, Water Cooled

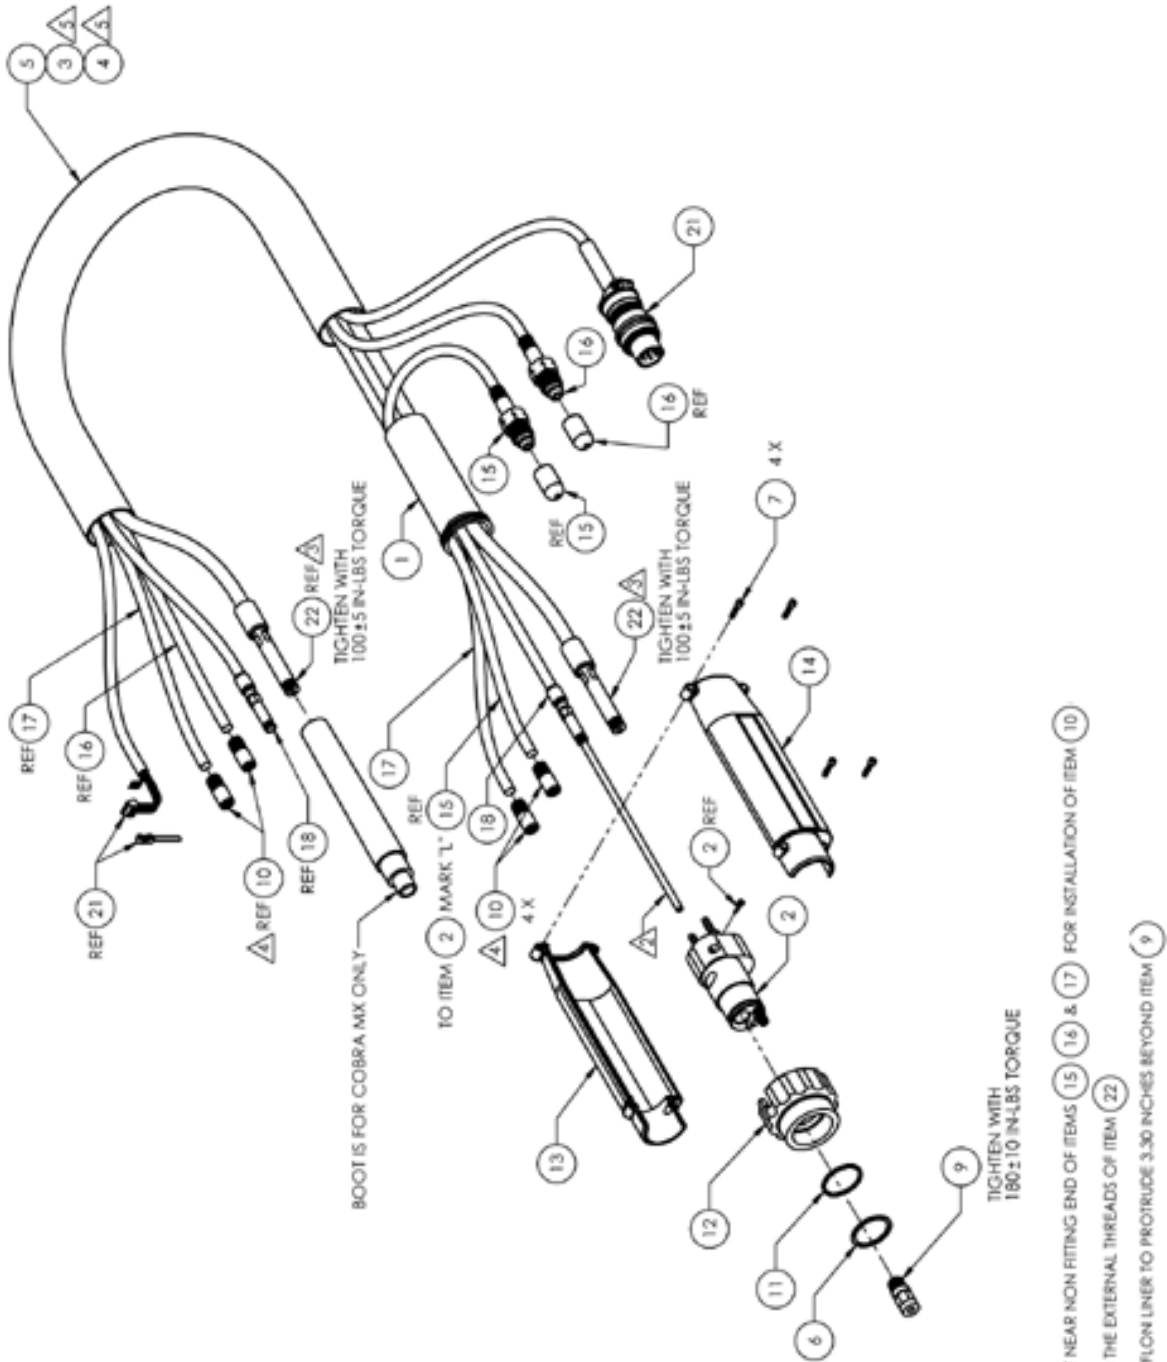


- ⚠ SEE PROCEDURE #033-0929.
- ⚠ APPLY QUICK DRYING HOSE LUBRICANT NEAR NON FITTING END OF ITEMS (15) (16) & (17) FOR INSTALLATION OF ITEM (10)
- ⚠ APPLY COMPOUND JOINT NOALOX TO THE EXTERNAL THREADS OF ITEM (22)
- ⚠ TRIM TEFLON LINER AFTER ASSEMBLY. TEFLON LINER TO PROTRUDE 3.30 INCHES BEYOND ITEM (9)
- ⚠ ITEM NOT SHOWN FOR CLARITY

| Lead Assembly - Water Cooled | | | | | | |
|------------------------------|------|-----------------------------|--------------|----------------|--------------|--------------|
| No. | Qty. | Description | 15' Part No. | 25' Part No. | 35' Part No. | 50' Part No. |
| 1 | 1 | Assy Boot Torch | | 003-2153 | | |
| 2 | 1 | Assy Power Manifold, W/C | | 003-2378 | | |
| 3 | △1 | Wrap Spiral Cord, 5.5 in | | 261-0094 | | |
| 4 | △1 | Wrap Spiral Cord, 13 in | | 261-0094-13 | | |
| 5 | 1 | Snake Skin | 931-0110 | 931-0122 | 931-0132 | 931-0123 |
| 6 | △1 | Retainer Ring | | 313-0144 | | |
| 7 | 4 | Screw SHC 4-40 x 1/2 SST | | 338-0014 | | |
| 8 | 4 | Tie Wrap | | 411-0045 | | |
| 9 | 1 | Conduit Liner Fitting | | 431-1788 | | |
| 10* | 4 | Hose Retainer, 5/16 | | 431-1898 | | |
| 11 | 1 | Washer for Euro Connection | | 431-2052 | | |
| 12 | 1 | Nut Handle Adapter | | 437-0265 | | |
| 13 | 1 | Handle Kit: Includes item 7 | | 005-0385-BLACK | | |
| 14 | 1 | | | | | |
| 15 | 1 | Assy Hose Water RED | | 552-0209 | | |
| 16 | 1 | Assy Hose Water, BLUE | 552-0239-15 | 552-0239-25 | 552-0239-35 | 552-0239-50 |
| 17 | 1 | Assy Gas Hose | 552-0241-15 | 552-0241-25 | 552-0241-35 | 552-0241-50 |
| 18 | 1 | Conduit Tef Tube | 615-0620-15 | 615-0620-25 | 615-0620-35 | 615-0620-50 |
| 19 | - | - | | ---- | | |
| 20 | - | - | | ---- | | |
| 21 | 1 | Assy Controller Cable | 005-0690 | 005-0691 | 005-0740 | 005-0692 |
| 22 | 1 | Assy Power Cable/Water Euro | 005-0388-15 | 005-0388-25 | 005-0388-35 | 005-0388-50 |


* Hose Retainer is re-usable and can be removed and re-installed as needed

Cobra MX Euro Compatible 7 Pin Power Manifold Assembly, Air Cooled, P/N 003-2373

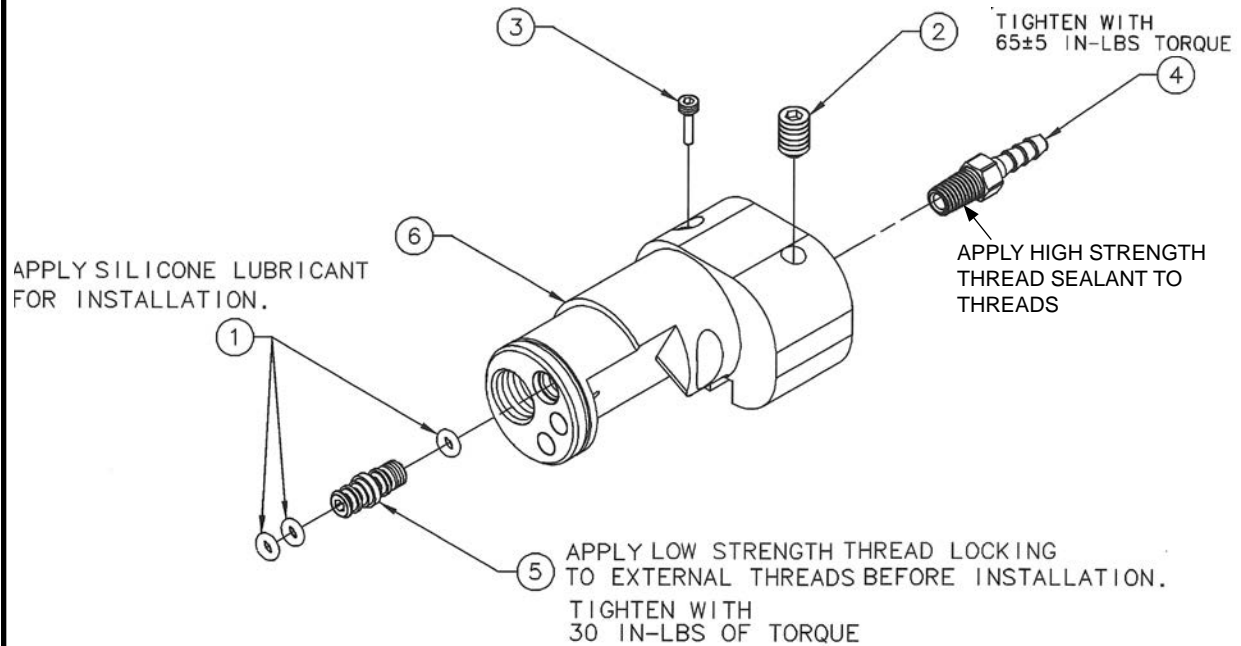


| Air Cooled Power Manifold Assembly | | | |
|------------------------------------|------|----------|-----------------------------------|
| No. | Qty. | Part No. | Description |
| 1 | 3 | 303-0097 | O-Ring Buna-N .101 ID x .07W |
| 2 | 1 | 321-1082 | Set Screw Flat 1/4 - 20 x 3/8 SST |
| 3 | 1 | 321-1104 | Set Screw Conduit |
| 4 | 1 | 431-1905 | Fitting 1/8 ID x 1/16 - 27 NPT |
| 5 | 1 | 431-1948 | Connector Thread |
| 6 | - | - | Not available separately |

Cobra MX Euro Compatible 7 Pin Power Manifold Assembly, Water Cooled, P/N 003-2378

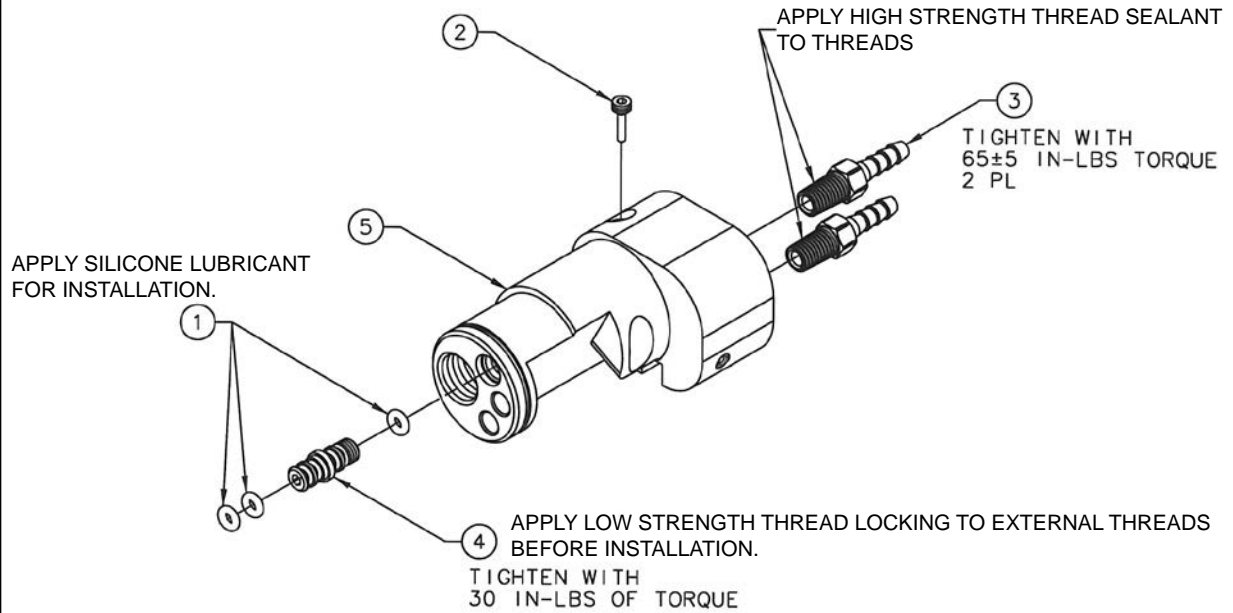


| Water Cooled Power Manifold Assembly | | | |
|--------------------------------------|------|----------|--------------------------------|
| No. | Qty. | Part No. | Description |
| 1 | 1 | 303-0097 | O-Ring Buna-N .101 ID x .07W |
| 2 | 1 | 321-1104 | Set Screw Conduit |
| 3 | 2 | 431-1905 | Fitting 1/8 ID x 1/16 - 27 NPT |
| 4 | 1 | 431-1948 | Connector Thread |
| 5 | - | - | Not available separately |

Cobra MX Euro Compatible 7 Pin Electrical

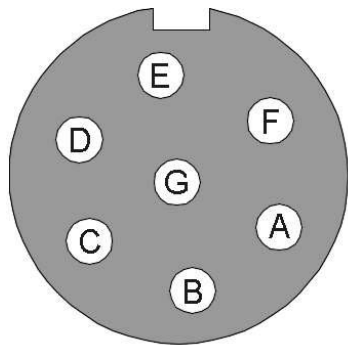

"W" Clocked
Amphenol Connector
Viewed from front of connector

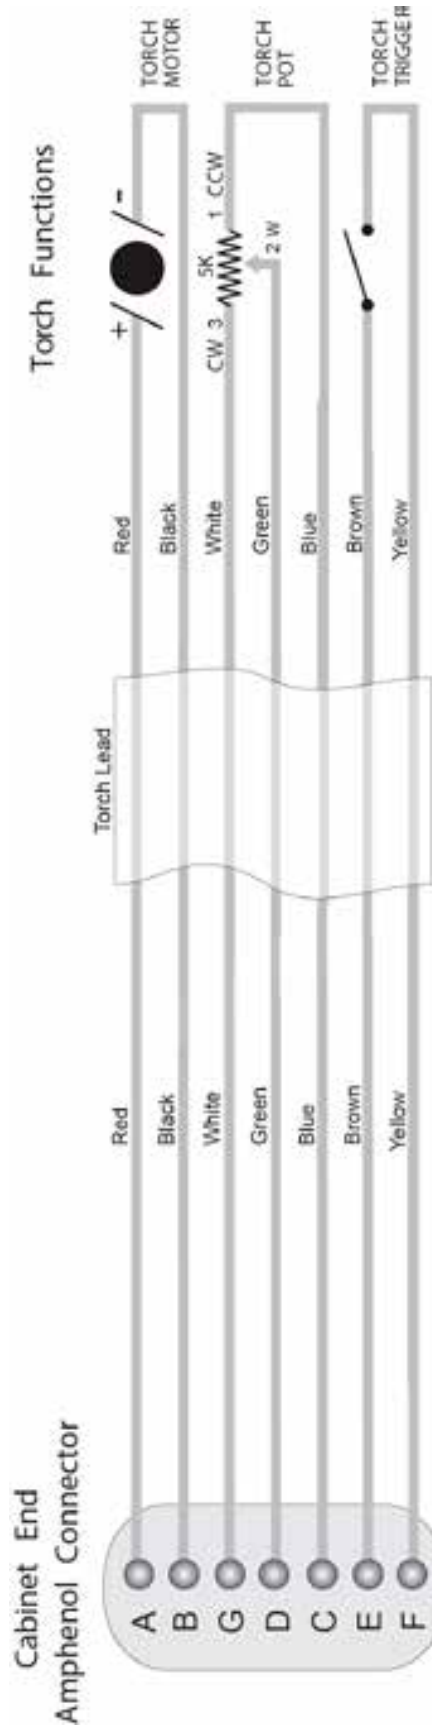

| | | | |
|-----------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------|
|  |  |  |  |
| WARNING | <ul style="list-style-type: none"> Do not touch electrically live parts or electrode with skin or wet clothing. Insulate yourself from work and ground. | <ul style="list-style-type: none"> Keep flammable materials away. | <ul style="list-style-type: none"> Wear eye, ear and body protection. |
| Spanish AVISO DE PRECAUCION | <ul style="list-style-type: none"> No toque las partes o los electrodos bajo carga con la piel o ropa mojada. Aislese del trabajo y de la tierra. | <ul style="list-style-type: none"> Mantenga el material combustible fuera del área de trabajo. | <ul style="list-style-type: none"> Protéjase los ojos, los oídos y el cuerpo. |
| French ATTENTION | <ul style="list-style-type: none"> Ne laissez ni la peau ni des vêtements mouillés entrer en contact avec des pièces sous tension. Isolez-vous du travail et de la terre. | <ul style="list-style-type: none"> Gardez à l'écart de tout matériel inflammable. | <ul style="list-style-type: none"> Protégez vos yeux, vos oreilles et votre corps. |
| German WARNUNG | <ul style="list-style-type: none"> Berühren Sie keine stromführenden Teile oder Elektroden mit Ihrem Körper oder feuchter Kleidung! Isolieren Sie sich von den Elektroden und dem Erdboden! | <ul style="list-style-type: none"> Entfernen Sie brennbares Material! | <ul style="list-style-type: none"> Tragen Sie Augen-, Ohren- und Körperschutz! |
| Portuguese ATENÇÃO | <ul style="list-style-type: none"> Não toque partes elétricas e electrodos com a pele ou roupa molhada. Isole-se da peça e terra. | <ul style="list-style-type: none"> Mantenha inflamáveis bem guardados. | <ul style="list-style-type: none"> Use proteção para a vista, ouvido e corpo. |
| Japanese 注意事項 | <ul style="list-style-type: none"> 通電中の電気部品、又は溶材にヒフやぬれた布で触れないこと。 施工物やアースから身体が絶縁されている様にして下さい。 | <ul style="list-style-type: none"> 燃えやすいものの側での溶接作業は絶対にしてはなりません。 | <ul style="list-style-type: none"> 目、耳及び身体に保護具をして下さい。 |
| Chinese 警告 | <ul style="list-style-type: none"> 皮肤或湿衣物切勿接触带电部件及焊条。 使你自已离地面和工作件绝缘。 | <ul style="list-style-type: none"> 把一切易燃物品移离工作场所。 | <ul style="list-style-type: none"> 佩戴眼、耳及身体劳动保护用具。 |
| Korean 위험 | <ul style="list-style-type: none"> 전도체나 용접봉을 젖은 환경 또는 피부로 절대 접촉치 마십시오. 모재와 접지를 접촉치 마십시오. | <ul style="list-style-type: none"> 인화성 물질을 접근 시키지 마십시오. | <ul style="list-style-type: none"> 눈, 귀와 몸에 보호장구를 착용하십시오. |
| Arabic تحذير | <ul style="list-style-type: none"> لا تلمس الأجزاء التي يمر بها التيار الكهربائي أو الأقطاب بجلد الجسم أو بالمعاطن المبللة بالماء. ضع عازلا على جسمك خلال العمل. | <ul style="list-style-type: none"> ضع المواد القابلة للاشتعال في مكان بعيد. | <ul style="list-style-type: none"> ضع أدوات وملابس واقية على عينيك وأذنيك وجسمك. |

READ AND UNDERSTAND THE MANUFACTURER'S INSTRUCTION FOR THIS EQUIPMENT AND THE CONSUMABLES TO BE USED AND FOLLOW YOUR EMPLOYER'S SAFETY PRACTICES.

SE RECOMIENDA LEER Y ENTENDER LAS INSTRUCCIONES DEL FABRICANTE PARA EL USO DE ESTE EQUIPO Y LOS CONSUMIBLES QUE VA A UTILIZAR, SIGA LAS MEDIDAS DE SEGURIDAD DE SU SUPERVISOR.

LISEZ ET COMPRENEZ LES INSTRUCTIONS DU FABRICANT EN CE QUI REGARDE CET EQUIPMENT ET LES PRODUITS A ETRE EMPLOYES ET SUIVEZ LES PROCEDURES DE SECURITE DE VOTRE EMPLOYEUR.

LESEN SIE UND BEFOLGEN SIE DIE BETRIEBSANLEITUNG DER ANLAGE UND DEN ELEKTRODENEINSATZ DES HERSTELLERS. DIE UNFALLVERHÜTUNGSVORSCHRIFTEN DES ARBEITGEBERS SIND EBENFALLS ZU BEACHTEN.

| | | | |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
|  |  |  |  |
| <ul style="list-style-type: none"> ● Keep your head out of fumes. ● Use ventilation or exhaust to remove fumes from breathing zone. | <ul style="list-style-type: none"> ● Turn power off before servicing. | <ul style="list-style-type: none"> ● Do not operate with panel open or guards off. | WARNING |
| <ul style="list-style-type: none"> ● Los humos fuera de la zona de respiración. ● Mantenga la cabeza fuera de los humos. Utilice ventilación o aspiración para gases. | <ul style="list-style-type: none"> ● Desconectar el cable de alimentación de poder de la máquina antes de iniciar cualquier servicio. | <ul style="list-style-type: none"> ● No operar con panel abierto o guardas quitadas. | Spanish AVISO DE PRECAUCION |
| <ul style="list-style-type: none"> ● Gardez la tête à l'écart des fumées. ● Utilisez un ventilateur ou un aspirateur pour ôter les fumées des zones de travail. | <ul style="list-style-type: none"> ● Débranchez le courant avant l'entretien. | <ul style="list-style-type: none"> ● N'opérez pas avec les panneaux ouverts ou avec les dispositifs de protection enlevés. | French ATTENTION |
| <ul style="list-style-type: none"> ● Vermeiden Sie das Einatmen von Schweißrauch! ● Sorgen Sie für gute Be- und Entlüftung des Arbeitsplatzes! | <ul style="list-style-type: none"> ● Strom vor Wartungsarbeiten abschalten! (Netzstrom völlig öffnen; Maschine anhalten!) | <ul style="list-style-type: none"> ● Anlage nie ohne Schutzgehäuse oder Innenschutzverkleidung in Betrieb setzen! | German WARNUNG |
| <ul style="list-style-type: none"> ● Mantenha seu rosto da fumaça. ● Use ventilação e exaustão para remover fumo da zona respiratória. | <ul style="list-style-type: none"> ● Não opere com as tampas removidas. ● Desligue a corrente antes de fazer serviço. ● Não toque as partes elétricas nuas. | <ul style="list-style-type: none"> ● Mantenha-se afastado das partes moventes. ● Não opere com os painéis abertos ou guardas removidas. | Portuguese ATENÇÃO |
| <ul style="list-style-type: none"> ● ヒュームから顔を離すようにして下さい。 ● 換気や排煙に十分留意して下さい。 | <ul style="list-style-type: none"> ● メンテナンス・サービスに取りかかる際には、まず電源スイッチを必ず切って下さい。 | <ul style="list-style-type: none"> ● パネルやカバーを取り外したまま機械操作をしないで下さい。 | Japanese 注意事項 |
| <ul style="list-style-type: none"> ● 頭部遠離煙霧。 ● 在呼吸區使用通風或排風器除煙。 | <ul style="list-style-type: none"> ● 維修前切斷電源。 | <ul style="list-style-type: none"> ● 儀表板打開或沒有安全罩時不準作業。 | Chinese 警告 |
| <ul style="list-style-type: none"> ● 얼굴로부터 용접가스를 멀리하십시오. ● 호흡지역으로부터 용접가스를 제거하기 위해 가스제거기나 통풍기를 사용하십시오. | <ul style="list-style-type: none"> ● 보수전에 전원을 차단하십시오. | <ul style="list-style-type: none"> ● 관널이 열린 상태로 작동치 마십시오. | Korean 위험 |
| <ul style="list-style-type: none"> ● بعد رأسك بعيداً عن الدخان. ● استعمل التهوية أو جهاز ضغط الدخان للخارج لكي تبعد الدخان عن المنطقة التي تتنفس فيها. | <ul style="list-style-type: none"> ● قطع التيار الكهربائي قبل القيام بأية صيانة. | <ul style="list-style-type: none"> ● لا تشغيل هذا الجهاز إذا كانت الاغطية الحديدية الوالفة ليست عليه. | Arabic تحذير |

LEIA E COMPREENDA AS INSTRUÇÕES DO FABRICANTE PARA ESTE EQUIPAMENTO E AS PARTES DE USO, E SIGA AS PRÁTICAS DE SEGURANÇA DO EMPREGADOR.

使う機械や溶材のメーカーの指示書をよく読み、まず理解して下さい。そして貴社の安全規定に従って下さい。

請詳細閱讀並理解製造廠提供的說明以及應該使用的銀焊材料，並請遵守貴方的有關勞動保護規定。

이 제품에 동봉된 작업지침서를 숙지하시고 귀사의 작업자 안전수칙을 준수하시기 바랍니다.

اقرأ بتمعن وافهم تعليمات المصنع المنتج لهذه المعدات والمواد قبل استعمالها واتبع تعليمات الوقاية لصاحب العمل.

LIMITED WARRANTY

Effective August 1, 2010

This warranty supersedes all previous MK Products warranties and is exclusive, with no other guarantees or warranties expressed or implied.

LIMITED WARRANTY - MK Products Inc., Irvine, California warrants that all new and unused equipment furnished by MK Products is free from defects in workmanship and material as of the time and place of delivery by MK Products. No warranty is made by MK Products with respect to trade accessories or other items manufactured by others. Such trade accessories and other items are sold subject to the warranties of their respective manufacturers, if any.

MK Products' warranty does not apply to components having normal useful life of less than one (1) year, such as relay points, wire conduit, tungsten, and welding gun parts that come in contact with the welding wire, including gas cups, gas cup insulators, and contact tips where failure does not result from defect in workmanship or material.

MK Products shall, exclusively remedy the limited warranty or any duties with respect to the quality of goods, based upon the following options:

- (1) repair
- (2) replacement
- (3) where authorized in writing by MK Products, the reasonable cost of repair or replacement at our Irvine, California plant.

As a matter of general policy only, MK Products may honor an original user's warranty claims on warranted equipment in the event of failure resulting from a defect within the following periods from the date of delivery of equipment to the original user:

- 1. Power Supplies and Wire Feed Cabinets **3 years**
- 2. Weldheads, Coolers, Positioners, and Push-Pull Guns ... **1 year**
- 3. Spool Guns, and Spool Gun Modules **180 days**
- 4. Repairs/Exchanges/Parts **90 days**

Classification of any item into the foregoing categories shall be at sole discretion of MK Products. Notification of any failure must be in writing within 30 days of such failure.

A copy of the invoice showing the date of sale must accompany products returned for warranty repair or replacement.

All equipment returned to MK Products for service must be properly packaged to guard against damage from shipping. MK Products not be responsible for any damages resulting from shipping.

Normal surface transportation charges (one way) for products returned for warranty repair or replacement will be borne by MK Products, except for products sold to foreign markets.

ANY EXPRESS WARRANTY NOT PROVIDED HEREIN AND ANY IMPLIED WARRANTY, GUARANTEE, OR REPRESENTATION AS TO PERFORMANCE AND ANY REMEDY FOR BREACH OF CONTRACT WHICH, BUT FOR THIS PROVISION, MIGHT ARISE BY IMPLICATION, OPERATION OF LAW, CUSTOM OF TRADE, OR COURSE OF DEALING, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR OF FITNESS FOR PARTICULAR PURPOSE, WITH RESPECT TO ANY AND ALL EQUIPMENT FURNISHED BY MK PRODUCTS, IS EXCLUDED AND DISCLAIMED BY MK PRODUCTS.

EXCEPT AS EXPRESSLY PROVIDED BY MK PRODUCTS IN WRITING, MK'S PRODUCTS ARE INTENDED FOR ULTIMATE PURCHASE BY COMMERCIAL/INDUSTRIAL USERS AND FOR OPERATION BY PERSONS TRAINED AND EXPERIENCED IN THE USE AND MAINTENANCE OF WELDING EQUIPMENT AND NOT FOR CONSUMERS OR CONSUMER USE. MK PRODUCTS' WARRANTIES DO NOT EXTEND TO, AND RESELLER IS AUTHORIZED TO EXTEND MK PRODUCTS' WARRANTY TO ANY CONSUMER.

USE OF OTHER THAN **GENUINE** MK PRODUCTS' CONSUMABLES, PARTS, AND ACCESSORIES MAY INVALIDATE YOUR PRODUCT WARRANTY.



16882 Armstrong Ave.
Irvine, CA 92606
Tel (949) 863-1234
Fax (949) 474-1428
www.mkproducts.com

August 1, 2010



www.mkproducts.com

16882 Armstrong Ave.

Irvine, California 92606

TEL (949) 863-1234 FAX (949) 474-1428